

BST Eltromat France SARL Impasse de la Noisette - CE402 F-91374 Verrières le Buisson Tél.: +33 1 69 20 07 41 Email: bstfrance@bst.group Web: https://www.bst.elexis.group/	Socoplan (Arcade Beauty) ACU230223 M. Franck Bourdon 12 All. De Dissé 79600 Airvault France +33 6 07 48 31 95 / +33 5 49 64 95 01 f.bourdon@arcadebeauty.com
--	---

Preventive reference number	PMREPORT-291_PM916_2025-06-16
Contract number / Numéro de contrat	CM2112043 R2
Contract date:	2024/01/01 -> 2026/12/31
Machine customer name:	DCM 3
Assign to:	RelR
Material:	VIDEO_IPQ_Center
Type:	iPQ Center
SN:WA:	ASO076651_WA21547
Origin BST France order:	212174
Installation date of material:	2021/08/26

TECHNICAL DATAS

PC MODEL	IPC-BG-BKA-BSTE03.0-2
PC NAME	21547IPQ-Center1-1
ADDITIONAL CAMERA INFO	iPQ Center
OPERATION SYSTEM	Windows 10 Enterprise LTSC - v1809
MEMORY RAM	64 GB
FREE SPACE ON C	44.3 / 75.1 GB
FREE SPACE ON D	F:\ 7.15 / 7.27 TB
TEAMVIEWER ID	280 278 141 / v15
IP ADDRESS EXTERN FOR INTERNET	IP address : 172.20.11.50 Subnet mask : 255.255.255.0 Default gateway : 172.20.11.254 Preferred DNS server : 172.20.20.10 Alternate DNS server : 10.217.3.10
ORIGINAL VERSION	2.17.9
UPG OR DNG VERSION DURING MAINTENANCE	No software upgrade recommended

Start time PM:	16/06/2025 14:02
End time PM:	16/06/2025 17:00

		COMMENTS			COMMENTS
Touchmonitorcalibration	✓		Ipqchecksynchronization	✓	
Pcscreenresolutiontouch		1920X1080	Ipqencoderwheelfixing	✓	
Pcscreenresolutionview		1920X1080	Ipqencoderwheelstatus	✓	
Hardwareconditionscrews	✓		Ipqencoderwheelrunningonweb	✓	
Hardwareconditioncables	✓		Alarmstatusindicator	✓	
Hardwareconditionconnectors	✓		Upsbatteryexchanged	⏸	A surveiller UPS d'origine. Durer de de vie 5ans approximativement.
Digitalcheckfan	✓		Upsdatebatteryexchanged		UPS builder recommand to exchange every 4 years.
Digitalreplacefilter	✓		Installation date:		2021-08-26 -> 03 YEAR(S)
Traversecamera	✓		Upscommunicationchecking	✓	
Traversecameralenscleaning	✓		Softwareupdate	⏸	
Traversewscamerareplaceflashbulb	✓	Echanger 3 Flash bulbs avec des Flash 2nde main. Toutes fonctionnent mais a changer les 8 a prochaine maintenance.	Version upgraded		
Traversewscameracleanwindows	✓		Softwareipqtcu		1.12
Camerachangefiltercheckfan	✓		Softwareipqwsc		1.9.6
Traversewscamerashadowreducingbackplate	✓		Softwareipppps		2.2
Traversewscameracheckflashbulblackerflash	⏸		Softwareipqili		1.4.3
Traversewscameracheckcleanmirrorlackercamera	⏸		Softwareworkflowcommunication	✓	
Traversewscameracheckzoomirisfocuswsboard	✓		Softwareremote	✓	
Traversewscameracalibrationzoomirisfocus	✓		Operatorinstructions	⏸	
Traversebackflash	⏸		Backupscreenshots	✓	Attachés au rapport.
Traversebackflashflashbulb	⏸		Backupimage	⏸	
Linecameracleanmirror	✓		Backupsoftware	✓	
Led checking+reflector checking+dome	✓				
Linecameramechanicalcheck	✓				
Linecamerabacklightmechanicalcheckjigs	✓				
Camera mechanicalalignementtoprint	✓				
Camera whitecalibration	✓	A voir images attachées.			

- ✓: Checked, nothing to report / Vérifié, RAS
 ✗: Not OK, checked comment / Pas OK, vérifiez commentaires
 ⏸: Not actif / Non Actif

Comment(s)

(If fields are not visible please open PDF file with Google chrome or Microsoft edge nagivator or update your navigator)

Customer signature:

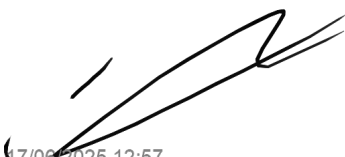
Name:

Date :

BST eltromat FRANCE signature:

Name:

Date :


17/06/2025 12:57


17/06/2025 19:47

ATTACHED PM'S FILE(S)

[Apres calibration](#)



[Avant calibration](#)



[UPS OK](#)

