

BST Eltromat France SARL Impasse de la Noisette - CE402 F-91374 Verrières le Buisson Tél.: +33 1 69 20 07 41 Email: bstfrance@bst.group Web: https://www.bst.elexis.group/	BBC CELLPACK Packaging ACU231328 M. Laurent Keller 20 Rue Bumkirch - BP20 68720 Illfurth France +33 3 89 68 79 73 laurent.keller@cellpack.com
--	--

Preventive reference number	PMREPORT-249_PM859_2025-04-03
Contract number / Numéro de contrat	CM2309055
Contract date:	2023/10/01 -> 2026/09/30
Machine customer name:	i69
Assign to:	DarA
Material:	VIDEO_IPQ_Center
Type:	iPQ View
SN:WA:	ASO024725_WA0019053
Installation date of material:	2015/01/30

TECHNICAL DATAS

PC MODEL	dell-XE2-i5-4570S
PC NAME	19053iPQ-Center1-1
ADDITIONAL CAMERA INFO	iPQ View
OPERATION SYSTEM	Windows Embedded Standard / SP1
MEMORY RAM	8 GB
FREE SPACE ON C	22.8 / 48.8 GB
FREE SPACE ON D	F: 215 / 216 GB
TEAMVIEWER ID	1 986 843 823 / v15
IP ADDRESS EXTERN FOR INTERNET	DHCP Automatic
ORIGINAL VERSION	2.17.9
UPG OR DNG VERSION DURING MAINTENANCE	No software upgrade recommended

Start time PM:	03/04/2025 20:30
End time PM:	03/04/2025 12:30

		COMMENTS			COMMENTS
Touchmonitorcalibration	✓		Ipqchecksynchronization	⏸	
Pcscreenresolutiontouch		1920x1080 Touch 23"	Ipqencoderwheelfixing	⏸	
Pcscreenresolutionview		1920x1080 View 43"	Ipqencoderwheelstatus	⏸	
Hardwareconditionscrews	✓		Ipqencoderwheelrunningonweb	⏸	
Hardwareconditioncables	✓		Alarmstatusindicator	⏸	
Hardwareconditionconnectors	✓		Upsbatteryexchanged	✗	
Digitalcheckfan	✓	Additional fan to the dell computer	Upsdatebatteryexchanged		UPS builder recommand to exchange every 4 years.
Digitalreplacefilter	✓		Installation date:		2015-01-30 -> 10 YEAR(S)
Traversecamera	✓	Rollenkassette FDA15-K replaced on both traverses	Upscommunicationchecking	✓	
Traversecameralenscleaning	✓		Softwareupdate	⏸	Last version possible on the computer
Traversewscamerareplaceflashbulb	✗	Next maintenance	Version upgraded		
Traversewscameracleanwindows	✓		Softwareipqtcu		1.12
Camerachangefiltercheckfan	✓		Softwareipqwsc		Top 1.9.6 / Bottom 1.9.7
Traversewscamerashadowreducingbackplate	✓		Softwareipqpps		2.2
Traversewscameracheckflashbulblackerflash	✗	Next Maintenance on Top camera	Softwareipqili		-
Traversewscameracheckcleanmirrorlackercamera	✓		Softwareworkflowcommunication	⏸	
Traversewscameracheckzoomirisfocuswscboard	✓		Softwareremote	✓	
Traversewscameracalibrationzoomirisfocus	✓		Operatorinstructions	⏸	
Traversebackflash	⏸		Backupscreenshots	✓	
Traversebackflashflashbulb	⏸		Backupimage	⏸	
Linecameracleanmirror	⏸		Backupsoftware	✓	ipq-center_bak_2025_04_03_08_42_43
Led checking+reflector checking+dome	⏸				
Linecameramechanicalcheck	⏸				
Linecamerabacklightmechanicalcheckjigs	⏸				
Camera mechanicalalignementtoprint	⏸				
Camera whitecalibration	⏸				

✓: Checked, nothing to report / Vérifié, RAS
 ✗: Not OK, checked comment / Pas OK, vérifiez commentaires
 ⏸: Not actif / Non Actif

Comment(s)

(If fields are not visible please open PDF file with Google chrome or Microsoft edge navigator or update your navigator)

Preventive Maintenance.

2x8 Flash Bulbs pour la prochaine maintenance + Varnish

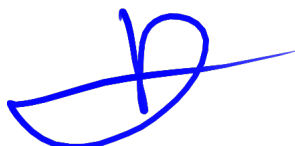
1LVWS245213-R - Rollenkassette FDA15-K - Roulement traverse

IPO View (matrix) remplacées sur les deux traverses

Customer signature:

Name:

Date :



03-Apr-25 4:57 PM

BST eltromat FRANCE signature:

 
 
 
Name:

Date :



03-Apr-25 4:45 PM

ATTACHED PM'S FILE(S)

Picture 03042025 	CDE_250123-0279 	SH2501-0338 	BL2501-0266 	Rollenkassette Top 
Rollenkassette Bottom 	Screenshot 03042025 	visconfig-Setup-Camera-Whitefader-camTop - wsc_522 - BC 	visconfig-Setup-Camera-Whitefader-camTop - wsc_522 - AC 	visconfig-Setup-Camera-Iris-camTop - wsc_522 
visconfig-Setup-Camera-Whitefader-camBot - wsc_522 - BC 	visconfig-Setup-Camera-Whitefader-camBot - wsc_522 - AC 	visconfig-Setup-Camera-Iris-camBot - wsc_522 