

BST Eltromat France SARL Impasse de la Noisette - CE402 F-91374 Verrières le Buisson Tél.: +33 1 69 20 07 41 Email: bstfrance@bst.group Web: https://www.bst.elexis.group/	DS Smith BRETAGNE 231598 M. Jean-Francois VELLER ZI Kervoasdou 29270 Carhaix Plouguer France +33 2 98 93 13 68
--	--

Preventive reference number	PMREPORT-146_PM721_2024-11-05
Contract number / Numéro de contrat	CM1801013
Contract date:	2021/03/01 -> 2024/02/29
Machine customer name:	Cobden Chadwick
Assign to:	DarA
Material:	VIDEO_IPQ_Center
Type:	iPQ Center
SN:WA:	ASO090731_WA0022231
Origin BST France order:	222281
Installation date of material:	2022/12/16

CUSTOMER ORDER:	CDE CLIENT M3 1022726.
-----------------	------------------------

TECHNICAL DATAS

PC MODEL	IPC-BG-BKA-BSTE04.0-7-A
PC NAME	22231iPQ-Center1-1
ADDITIONAL CAMERA INFO	iPQ Center
OPERATION SYSTEM	Windows 10 Enterprise LTSC
MEMORY RAM	96.0 GB
FREE SPACE ON C	28.3 / 75.0 FB
FREE SPACE ON D	F:\ 7.24 / 7.27 TB
TEAMVIEWER ID	https://citrixcloud.dssmith.com/logon/LogonPoint/index.html 1 285 328 030 / v12
IP ADDRESS EXTERN FOR INTERNET	
ORIGINAL VERSION	2.17.9
UPG OR DNG VERSION DURING MAINTENANCE	No software upgrade recommended

		COMMENTS			COMMENTS
Touchmonitorcalibration	✓		Ipqchecksynchronization	✓	
Pcscreenresolutiontouch		1920x1080 Touch	Ipqencoderwheelfixing	✓	
Pcscreenresolutionview		1920X1080 Full View+43"	Ipqencoderwheelstatus	✓	
Hardwareconditionscrews	✓		Ipqencoderwheelrunningonweb	✓	
Hardwareconditioncables	✓		Alarmstatusindicator	✓	
Hardwareconditionconnectors	✓		Upsbatteryexchanged	⏸	
Digitalcheckfan	✓		Upsdatebatteryexchanged		UPS builder recommand to exchange every 4 years.
Digitalreplacefilter	✓	4 filters	Installation date:		2022-12-16 -> 01 YEAR(S)
Traversecamera	✓		Upscommunicationchecking	✓	
Traversecameralenscleaning	✓		Softwareupdate	⏸	
Traversewscamerareplaceflashbulb	✓	8 Flash Bulbs	Version upgraded		
Traversewscameracleanwindows	✓		Softwareipqtcu		1.12
Camerachangefiltercheckfan	✓	2 Filters	Softwareipqwsc		1.9.6
Traversewscamerashadowreducingbackplate	⏸	Doesn't exist	Softwareipqpps		2.2
Traversewscameracheckflashbulblackerflash	⏸		Softwareipqili		1.4.3
Traversewscameracheckcleanmirrorlackercamera	⏸		Softwareworkflowcommunication	⏸	
Traversewscameracheckzoomirisfocuswsboard	✓		Softwareremote	✓	Via Citrix + VNC (QA)
Traversewscameracalibrationzoomirisfocus	✓		Operatorinstructions	✓	
Traversebackflash	⏸		Backupscreenshots	✓	
Traversebackflashflashbulb	⏸		Backupimage	⏸	
Linecameracleanmirror	✓		Backupssoftware	⏸	ipq-center_bak_2024_11_05_13_39_06
Led checking+reflector checking+dome	✓				
Linecameramechanicalcheck	✓	No back Board			
Linecamerabacklightmechanicalcheckjigs	⏸				
Camerasmechanicalalignementtoprint	✓				
Camerawhitecalibration	✓	Offset + Gain			

- ✓: Checked, nothing to report / Vérifié, RAS
 ✗: Not OK, checked comment / Pas OK, vérifiez commentaires
 ⏸: Not actif / Non Actif

Comment(s)

(If fields are not visible please open PDF file with Google chrome or Microsoft edge navigator or update your navigator)

Preventive Maintenance on system iPQ Center. 8 Flash Bulbs replaced + camera calibrated.
Line Camera Offset/Gain.

Customer signature:

Name:

Date :


mardi 5 novembre 2024 15:27:56

 
 
 
BST eltromat FRANCE signature:

Name:

Date :


mardi 5 novembre 2024 15:28:13

ATTACHED PM'S FILE(S)

Offre_241011-0210 	CDE CLIENT M3 1022726. 	BL2411-0238 	Full View Before PM 	sysconfig-Setup-Camera-Whitefader-BC 
sysconfig-Setup-Camera-Whitefader-AC 	sysconfig-Setup-LineCam-imp0-BC 	CST board0-port0 - imp0 - Gain 	sysconfig-Setup-LineCam-imp1-BC 	CST board1-port0 - imp1 - Gain 
sysconfig-Setup-LineCam-imp2-BC 	CST board2-port0 - imp2 - Gain 	sysconfig-Setup-LineCam-imp3-BC 	CST board3-port0 - imp3 - Gain 	Full View After PM 
Full View After PM 2 	UPS Status 	Screenshot 05112024 	Picture 05112024 	