

BST Eltromat France SARL Impasse de la Noisette - CE402 F-91374 Verrières le Buisson Tél.: +33 1 69 20 07 41 Email: bstfrance@bst.group Web: https://www.bst.elexis.group/	CCL Package Label - Tabacco (Chilly-Mazarin) ACU231910 Mme Nina Bühlmann 3 rue Denis Papin 91380 Chilly-Mazarin France +33 6 63 75 08 72 nbuhlmann@cclind.com
--	--

Preventive reference number	PMREPORT-353_PM995_2025-11-04
Contract number / Numéro de contrat	CM1708005
Contract date:	2022/01/01 -> 2024/12/31
Machine customer name:	S22
Assign to:	DarA
Material:	VIDEO_Tubescan_DS
Type:	DS 550 4000 / M2032aC 0.1388
SN:WA:	ASO090407_42.2358
Origin BST France order:	222268
Installation date of material:	2023/08/16

TECHNICAL DATAS

PC MODEL	OptiPlex 7090 / Tag F0TGGR3
PC NAME	TubeScan422358
ADDITIONAL CAMERA INFO	DS 550 4000 / M2032aC 0.1388
OPERATION SYSTEM	Microsoft Windows 10 Pro 21H1
MEMORY RAM	16,0 GB (15,7 GB usable)
FREE SPACE ON C	122 / 237 GB
FREE SPACE ON D	bst_qlink\$ (lblchisrv43.ccleurope.cclind.net)
TEAMVIEWER ID	1 073 257 088 / v15
IP ADDRESS EXTERN FOR INTERNET	Automatic IP
ORIGINAL VERSION	7.4.60.22448
UPGRADE OR DOWNGRADE VERSION LAST INTERVENTION	TubeScan_8.0.42.40103.hotfix-14 from E2744
UPG OR DNG VERSION DURING MAINTENANCE	No software upgrade recommended

Start time PM:	03/11/2025 10:00
End time PM:	03/11/2025 12:30

COMMENTS			COMMENTS		
Touch monitor calibration	✓		Fixation encoder	✓	
Touch monitor resolution		1024x768	Encoder wheel status	✓	Replaced 03/11/2025
View monitor resolution		1920x1080	Encoder wheel on web?	✗	On roller
Fixation screws of system?	✓		Spring(s) encoder status ?	✓	
Cables status ?	✓		Alarm indicator status ?	⏸	
Connectors cameras (well tight?)	✓		UPS battery exchanged ?	⏸	
PC's fans ?	✓		Date UPS's batteries exchanged ?		<u>OLD UPS APC NEW UPS EATON</u> recommand to exchange every 5 years.
PC's filter	⏸		Installation date:		2023-08-16 -> 02 YEAR(S)
Lens cleaning	✓	2 cameras looking down	UPS communication?	✓	UPS software, shutdown settings, and task scheduling configured with customer's UPS (Eaton 5SC750 & 3S700)
Mirror cleaning	⏸		Softwareworkflowcommunication	✓	bst_qlink\$ (lblchisrv43.ccleurope.cclind.net)
Backing or RRB cleaining	✓	Need to replace	Check Teamviewer access	✓	1 073 257 088 / v15
Lens Focal	✓		Calibration of camera detail & 100%camera	⏸	
Camera alignement with printing	✓	Mecanical alignment	Operators instruction ?	⏸	
Check web under camera	✓		Screenshots	✓	On v8.0.42.40103.hotfix-14
Height compensator calib	✓		ACRONIS ?	✓	On v8.0.42.40103.hotfix-14
Encoder offset calib	✓		Backup application	✓	On v8.0.42.40103.hotfix-14
Only with EV- LED calibrations					

Kisspoint only with 2 cameras		
-------------------------------	---	--

Filled quantity needed for quotation:

(if fields are not visible please open PDF file with Google chrome or Microsoft edge navigator or update your navigator)

- ✓ ENCODER WHEEL:: 2RDHO234275
- ✓ LED Board equipped V40 L=140mm: 1ELLT256485
- ✓ LED Board equipped V40 L=160mm: 1ELLT256486
- ✓ ENCODER'S SPRING
- ✓ BACKPLATE W/B

- ✓: Checked, nothing to report / Vérifié, RAS
- ✗: Not OK, checked comment / Pas OK, vérifiez commentaires
- ⏸: Not actif / Non Actif

Comment(s)

(If fields are not visible please open PDF file with Google chrome or Microsoft edge navigator or update your navigator)

Preventive Maintenance Completed - Software upgraded to the latest release version. - UPS software, shutdown settings, and task scheduling configured with customer 's UPS (Eaton 5SC750 & 3S700). - Auto computer start-up on Power ON configured, and safe shutdown (application + OS) on hard Power OFF enabled. - Encoder wheel replaced. - Camera mechanically adjusted (horizontal).

Customer signature:

Name:

Date :

BST eltromat FRANCE signature:

Name:

Date :



04-Nov-25 3:26 PM



04-Nov-25 3:22 PM

ATTACHED PM'S FILE(S)

Picture 03112025	Screenshot 03112025
	