

BST Eltromat France SARL Impasse de la Noisette - CE402 F-91374 Verrières le Buisson Tél.: +33 1 69 20 07 41 Email: bstfrance@bst.group Web: https://www.bst.elexis.group/	Helios Périers ACU309170 M. Dupray Sebastien Route de Carentan 50190 Périers France +33 2 33 17 13 13 / +33 6 49 15 30 68 sdupray@helios-imp.com
--	---

Preventive reference number	PMREPORT-300_PM926_2025-06-26
Contract number / Numéro de contrat	CM1912027
Contract date:	2023/02/01 -> 2026/01/31
Machine customer name:	Biva 2 - CI12894
Assign to:	CouV
Material:	VIDEO_IPQ_Center
Type:	iPQ Center
SN:WA:	WA19168
Installation date of material:	2015/12/01

TECHNICAL DATAS

PC MODEL	IPC-BG-R7910/BSTE01.0
PC NAME	19168iPQ-Center-1-1
ADDITIONAL CAMERA INFO	iPQ Center
OPERATION SYSTEM	WINDOWS EMBEDDED Standard
MEMORY RAM	32Go
FREE SPACE ON C	81.2GB
FREE SPACE ON D	103GB
TEAMVIEWER ID	764 599 361
IP ADDRESS EXTERN FOR INTERNET	192.168.55.21 255.255.255.0 192.168.55.3 DNS:192.168.55.6
ORIGINAL VERSION	2.17.9
UPG OR DNG VERSION DURING MAINTENANCE	No software upgrade recommended

Start time PM:	24/06/2025 13:30
End time PM:	24/06/2025 15:30

		COMMENTS			COMMENTS
Touchmonitorcalibration	✓		Ipqchecksynchronization	✓	
Pcscreenresolutiontouch		1920X1080	Ipqencoderwheelfixing	✓	
Pcscreenresolutionview		1920X1080	Ipqencoderwheelstatus	✓	
Hardwareconditionscrews	✓		Ipqencoderwheelrunningonweb	✓	
Hardwareconditioncables	✗	The video cables of the 100% cam need to be replaced. Blue dot on the screen generating false detection	Alarmstatusindicator	✓	
Hardwareconditionconnectors	✓		Upsbatteryexchanged	⏸	
Digitalcheckfan	✓		Upsdatebatteryexchanged		UPS builder recommand to exchange every 4 years.
Digitalreplacefilter	✓		Installation date:		2015-12-01 -> 09 YEAR(S)
Traversecamera	✓		Upscommunicationchecking	✓	
Traversecameralenscleaning	✓		Softwareupdate	⏸	
Traversewscamerareplaceflashbulb	✓		Version upgraded		
Traversewscameracleanwindows	✓		Softwareipqtcu		1.12
Camerachangefiltercheckfan	✓		Softwareipqwsc		1.9.6
Traversewscamerashadowreducingbackplate	✓		Softwareipqpps		2.2
Traversewscameracheckflashbulblackerflash	⏸		Softwareipqli		1.4.3
Traversewscameracheckcleanmirrorlackercamera	⏸		Softwareworkflowcommunication	✓	
Traversewscameracheckzoomirisfocuswscboard	✓		Softwareremote	✓	
Traversewscameracalibrationzoomirisfocus	⏸		Operatorinstructions	⏸	
Traversebackflash	⏸		Backupscreenshots	✓	
Traversebackflashflashbulb	⏸		Backupimage	⏸	
Linecameracleanmirror	✓		Backupsoftware	✓	
Led checking+reflector checking+dome	✓				
Linecameramechanicalcheck	✓				
Linecamerabacklightmechanicalcheckjigs	✓				
Camera mechanicalalignementtoprint	✓				
Camera whitecalibration	✓				

- ✓: Checked, nothing to report / Vérifié, RAS
✗: Not OK, checked comment / Pas OK, vérifiez commentaires
⏸: Not actif / Non Actif

Comment(s)

(If fields are not visible please open PDF file with Google chrome or Microsoft edge nagivator or update your navigator)

Prevoir devis pour le remplacement de câbles video Cam 100%

Customer signature:

Name:

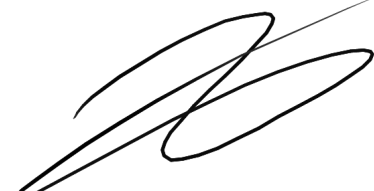
Date :

BST eltromat FRANCE signature:

Name:

Date :


26/06/2025 16:44


27/06/2025 12:27