

BST Eltromat France SARL Impasse de la Noisette - CE402 F-91374 Verrières le Buisson Tél.: +33 1 69 20 07 41 Email: bstfrance@bst.group Web: https://www.bst.elexis.group/	DS Smith (Contoire-Hamel) xxx M. Stéphane Ryckebusch 570 Rue national Contoire-Hamel 80500 Trois-Rivières France +33 7 88 98 25 49 stephane.ryckebusch@dssmith.com
--	---

Preventive reference number	PMREPORT-373_PM1017_2025-11-20
Contract number / Numéro de contrat	CM2012036
Contract date:	2024/12/01 -> 2027/11/30
Machine customer name:	Cobden Chadwick
Assign to:	DarA
Material:	VIDEO_IPQ_Center
Type:	iPQ Center
SN:WA:	ASO092491_WA0021320
Origin BST France order:	222363
Installation date of material:	2023/02/06

TECHNICAL DATAS

PC MODEL	IPC-BG-BKA-BSTE04.2-7-A
PC NAME	21320-IPQ-1
ADDITIONAL CAMERA INFO	iPQ Center
OPERATION SYSTEM	Windows 10 Enterprise LTSC / 2018
MEMORY RAM	64 GB
FREE SPACE ON C	38.1 / 75.0 GB
FREE SPACE ON D	Protocol Hd (F:) 7.22 / 7.27 TB
TEAMVIEWER ID	1 649 168 535 / v15
IP ADDRESS EXTERN FOR INTERNET	192.168.1.21
ORIGINAL VERSION	3.1
UPG OR DNG VERSION DURING MAINTENANCE	No software upgrade recommended

Start time PM:	20/11/2025 08:30
End time PM:	20/11/2025 14:30

		COMMENTS			COMMENTS
Touchmonitorcalibration	✓		Ipqchecksynchronization	✓	
Pcscreenresolutiontouch		1920x1080	Ipqencoderwheelfixing	✓	
Pcscreenresolutionview		1920x1080	Ipqencoderwheelstatus	✓	
Hardwareconditionscrews	✓		Ipqencoderwheelrunningonweb	✓	
Hardwareconditioncables	✓		Alarmstatusindicator	✓	
Hardwareconditionconnectors	✓		Upsbatteryexchanged	✓	
Digitalcheckfan	✓		Upsdatebatteryexchanged		UPS builder recommand to exchange every 4 years.
Digitalreplacefilter	✓		Installation date:		2023-02-06 -> 02 YEAR(S)
Traversecamera	✓		Upscommunicationchecking	✓	
Traversecameralenscleaning	✓		Softwareupdate	⏸	
Traversewscamerareplaceflashbulb	⏸	Will be replaced during next maintenance	Version upgraded		
Traversewscameracleanwindows	✓		Softwareipqtcu		1.13
Camerachangefiltercheckfan	✓		Softwareipqwsc		1.9.6
Traversewscamerashadowreducingbackplate	⏸		Softwareippps		2.2
Traversewscameracheckflashbulblackerflash	⏸		Softwareipqili		1.4.3
Traversewscameracheckcleanmirrorlackercamera	⏸		Softwareworkflowcommunication	✓	Quality Assitant + Remote support
Traversewscameracheckzoomirisfocuswscboard	✓		Softwareremote	✓	Via platform Citrix
Traversewscameracalibrationzoomirisfocus	✓		Operatorinstructions	⏸	
Traversebackflash	⏸		Backupscreenshots	✓	
Traversebackflashflashbulb	⏸		Backupimage	⏸	
Linecameracleanmirror	✓		Backupsoftware	✓	ipq-center_bak_2025_11_20_12_53_43
Led checking+reflector checking+dome	✓				
Linecameramechanicalcheck	✓				
Linecamerabacklightmechanicalcheckjigs	⏸				
Cameramecanicalalignementtoprint	✓				
Camera whitecalibration	✗	The illumination control isn't working. Part 2ELLT327381-90 – ILICTRL.3 needs to be replaced. It's impossible to perform the calibration without being able to control the illumination			

- ✓: Checked, nothing to report / Vérifié, RAS
 ✗: Not OK, checked comment / Pas OK, vérifiez commentaires
 ⏸: Not actif / Non Actif

Comment(s)

(If fields are not visible please open PDF file with Google chrome or Microsoft edge navigator or update your navigator)

Preventive Maintenance Completed.

- Noise on the 4 cameras through the illumination. Need to replace board 2ELLT327381 - 90 - ILICTRL.3.

- No communication via RJ45 on ILI control. Same board to replace.

Missing plastic support filter on im2 camera. Need part 1EL DE220500 S

Customer signature:

Name:

Date :

BST eltromat FRANCE signature:

Name:

Date :



20-Nov-25 1:59 PM



20-Nov-25 2:00 PM

ATTACHED PM'S FILE(S)

Picture 20112025	Screenshot 20112025	sysconfig-Setup-Camera-Whitefader-AC	sysconfig-Setup-Camera-Iris	sysconfig-Setup-Camera-Zoom
				