

BST Eltromat France SARL Impasse de la Noisette - CE402 F-91374 Verrières le Buisson Tél.: +33 1 69 20 07 41 Email: bstfrance@bst.group Web: https://www.bst.elexis.group/	RKW Saint Freres Emballage S.A.S 231801 M. Stéphane Szczypa Rue Marius Sire 80420 Ville Le Marcelet France +33 3 22 39 49 00 / +33 7 64 40 00 65 stephane.szczypa@rkw-group.com
--	--

Preventive reference number	PMREPORT-367_PM1011_2025-11-13
Contract number / Numéro de contrat	CM2411068
Contract date:	2025/01/01 -> 2027/12/31
Machine customer name:	136
Assign to:	RelR
Material:	VIDEO_IPQ_Center
Type:	iPQ Center
SN:WA:	ASO086207_WA0021967
Installation date of material:	2024/03/15

TECHNICAL DATAS

PC MODEL	IPC-BG-BKA-BSTE04.0-5-A industrial PC High Speed 3ELEC445635 9556000295 BST GmbH
PC NAME	21967iPQ-Center1-
ADDITIONAL CAMERA INFO	iPQ Center
OPERATION SYSTEM	Windows 10 Entreprise LTSC / 2018
MEMORY RAM	96 GB
FREE SPACE ON C	31.9/75.0 GB
FREE SPACE ON D	96.5/97.5 GB
TEAMVIEWER ID	560 655 312 / v15
IP ADDRESS EXTERN FOR INTERNET	IP Address : 10.231.20.2 Subnet Mask : 255.255.0.0 Default Gateway : 10.231.1.1
ORIGINAL VERSION	2.17.9
UPG OR DNG VERSION DURING MAINTENANCE	No software upgrade recommended

Start time PM:	12/11/2025 13:30
End time PM:	12/11/2025 17:50

		COMMENTS			COMMENTS
Touchmonitorcalibration	✓		Ipqchecksynchronization	✓	
Pcscreenresolutiontouch		1920x1080	Ipqencoderwheelfixing	✓	
Pcscreenresolutionview		1920x1080	Ipqencoderwheelstatus	✓	
Hardwareconditionscrews	✓		Ipqencoderwheelrunningonweb	✓	
Hardwareconditioncables	✓		Alarmstatusindicator	✓	
Hardwareconditionconnectors	✓		Upsbatteryexchanged	⏸	
Digitalcheckfan	✓		Upsdatebatteryexchanged		UPS builder recommand to exchange every 4 years.
Digitalreplacefilter	✓		Installation date:		2024-03-15 -> 01 YEAR(S)
Traversecamera	✓		Upscommunicationchecking	✓	Rebrancher, application reinstaller.
Traversecameralenscleaning	✓		Softwareupdate	⏸	
Traversewscamerareplaceflashbulb	⏸		Version upgraded		
Traversewscameracleanwindows	✓		Softwareipqtcu		1.12
Camerachangefiltercheckfan	✓		Softwareipqwsc		1.9.6
Traversewscamerashadowreducingbackplate	✓		Softwareipqpps		2.3
Traversewscameracheckflashbulblackerflash	⏸		Softwareipqjli		1.4.3
Traversewscameracheckcleanmirrorlackercamera	⏸		Softwareworkflowcommunication	✓	
Traversewscameracheckzoomirisfocuswscboard	✓		Softwareremote	⏸	Pas d'internet IP configurer
Traversewscameracalibrationzoomirisfocus	✓		Operatorinstructions	⏸	
Traversebackflash	⏸		Backupscreenshots	⏸	
Traversebackflashflashbulb	⏸	8 OK: recommandation de changer a la prochaine visite	Backupimage	⏸	
Linecameracleanmirror	✓		Backupsoftware	✓	sur disque protocol. Pour un chargement plus rapide je conseille changement pour un disque dur plus petit et en SSD.
Led checking+reflector checking+dome	✓				
Linecameramechanicalcheck	✓				
Linecamerabacklightmechanicalcheckjigs	✓				
Camera mechanicalalignementtoprint	✓				
Camera whitecalibration	✓				

- ✓: Checked, nothing to report / Vérifié, RAS
 ✗: Not OK, checked comment / Pas OK, vérifiez commentaires
 ⏸: Not actif / Non Actif

Comment(s)

(If fields are not visible please open PDF file with Google chrome or Microsoft edge nagivator or update your navigator)

Customer signature:

Name: **Stephane Szczypa**

Date : **14/11/2025**

BST eltromat FRANCE signature:

Name: **Richard Relin**

Date : **14/11/2025**


14/11/2025 08:59


14/11/2025 12:20

ATTACHED PM'S FILE(S)

[Calibraion apres cam 1](#)



[Calibraion apres cam 2](#)

