

BST Eltromat France SARL Impasse de la Noisette - CE402 F-91374 Verrières le Buisson Tél.: +33 1 69 20 07 41 Email: bstfrance@bst.group Web: https://www.bst.elexis.group/	Elopak Morocco XXX Mr Abdelmajid Ihyaoui Sapino 783 parc industriel de Nouaceur 27182 Nouaceur Maroc +212 5 22 01 40 28 / +212 6 61 92 56 83 abdelmajid.ihyaoui@elopak.com
--	---

Preventive reference number	PMREPORT-308_PM945_2025-07-08
Contract number / Numéro de contrat	CM2402061
Contract date:	2025/02/01 -> 2028/01/31
Machine customer name:	Ligne 1
Assign to:	DarA
Material:	VIDEO_IPQ_View
Type:	iPQ View
SN:WA:	ASO101024_WA0022780
Origin BST France order:	232304
Installation date of material:	2024/02/06

CUSTOMER ORDER:	CDE CLIENT 55105954
-----------------	---------------------

TECHNICAL DATAS

PC MODEL	IPC-BKA-BSTE05
PC NAME	22780-IPQ-1
ADDITIONAL CAMERA INFO	iPQ View
OPERATION SYSTEM	Windows 10 Enterprise LTSC / 2018
MEMORY RAM	16 GB
FREE SPACE ON C	69.6 / 99.9 GB
FREE SPACE ON D	F: 393 / 394 GB
TEAMVIEWER ID	1 162 761 478 / v15
IP ADDRESS EXTERN FOR INTERNET	DHCP Automatic
ORIGINAL VERSION	3.1.1
UPG OR DNG VERSION DURING MAINTENANCE	No software upgrade recommended

Start time PM:	08/07/2025 13:30
End time PM:	08/07/2025 17:30

		COMMENTS			COMMENTS
Touchmonitorcalibration	✓		Ipqchecksynchronization		
Pcscreenresolutiontouch		1920x1080	Ipqencoderwheelfixing	⏸	
Pcscreenresolutionview			Ipqencoderwheelstatus	⏸	
Hardwareconditionscrews	✓		Ipqencoderwheelrunningonweb	⏸	
Hardwareconditioncables	✓		Alarmstatusindicator	⏸	
Hardwareconditionconnectors	✓		Upsbatteryexchanged	✓	Eaton 3S 700
Digitalcheckfan	✓		Upsdatebatteryexchanged		UPS builder recommand to exchange every 4 years.
Digitalreplacefilter	✓		Installation date:		2024-02-06 -> 01 YEAR(S)
Traversecamera	✓		Upscommunicationchecking	✓	
Traversecameralenscleaning	✓		Softwareupdate	✗	
Traversewscamerareplaceflashbulb	✓	8 Flash Bulbs replaced	Version upgraded		
Traversewscameracleanwindows	✓		Softwareipqtcu		1.13
Camerachangefiltercheckfan	✓		Softwareipqwsc		1.9.6
Traversewscamerashadowreducingbackplate	⏸	No back board	Softwareipqpps		-
Traversewscameracheckflashbulblackerflash	⏸		Softwareipqjli		-
Traversewscameracheckcleanmirrorlackercamera	⏸		Softwareworkflowcommunication	⏸	
Traversewscameracheckzoomirisfocuswscboard	✓		Softwareremote	✗	Need RJ45
Traversewscameracalibrationzoomirisfocus	✓		Operatorinstructions	⏸	
Traversebackflash	⏸		Backupscreenshots	✓	
Traversebackflashflashbulb	✗		Backupimage	✗	Error Acronis
			Backupsoftware	✓	ipq-center_bak_2025_07_08_15_13_26

- ✓: Checked, nothing to report / Vérifié, RAS
 ✗: Not OK, checked comment / Pas OK, vérifiez commentaires
 ⏸: Not actif / Non Actif

Comment(s)

(If fields are not visible please open PDF file with Google chrome or Microsoft edge navigator or update your navigator)

Preventive Maintenance - 8 Flash Bulbs replaced (Include in contract)

Customer signature:


Name:

Date :


BST eltromat FRANCE signature:

Name:

Date :

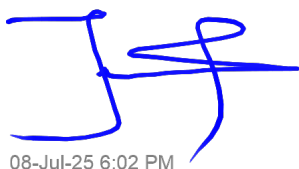

08-Jul-25 6:02 PM

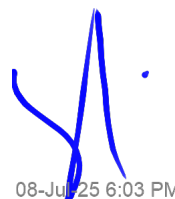

08-Jul-25 6:03 PM

ATTACHED PM'S FILE(S)

