

BST Eltromat France SARL Impasse de la Noisette - CE402 F-91374 Verrières le Buisson Tél.: +33 1 69 20 07 41 Email: bstfrance@bst.group Web: https://www.bst.elexis.group/	CONSTANTIA Jeanne d'Arc SAS 231032 M. François Bodhuin B.P. 51 52300 Vecqueville France +33 3 25 94 77 75 / +33 6 74 57 25 31 francois.bodhuin@cflex.com
--	---

Preventive reference number	PMREPORT-132_PM708_2024-09-24
Contract number / Numéro de contrat	CM2104038
Contract date:	2022/01/01 -> 2024/12/31
Machine customer name:	Comexi
Assign to:	RelR
Material:	VIDEO_IPQ_Center
Type:	iPQ Center
SN:WA:	ASO077271_WA21553
Installation date of material:	2022/02/24

TECHNICAL DATAS

PC MODEL	IPC-BG-BKA-BSTE03.0-3
PC NAME	21553iPQ-Center1-1
ADDITIONAL CAMERA INFO	iPQ Center
OPERATION SYSTEM	Windows 10 Enterprise LTSC
MEMORY RAM	64.0 GB
FREE SPACE ON C	37.2/75.1 GB
FREE SPACE ON D	F:\ 0.831 / 894 GB
TEAMVIEWER ID	1 126 221 355 / v15
IP ADDRESS EXTERN FOR INTERNET	IP Address : 10.140.164.140 Subnet mask : 255.255.255.0 Default gateway : 10.140.164.254 Preferred DNS server : 8.8.8.8 Alternate DNS server : 8.8.4.4
ORIGINAL VERSION	2.17.9
UPG OR DNG VERSION DURING MAINTENANCE	No software upgrade recommended

		COMMENTS			COMMENTS
Touchmonitorcalibration	OK		Ipqchecksynchronization	OK	
Pcscreenresolutiontouch		1920x1080	Ipqencoderwheelfixing	OK	
Pcscreenresolutionview		1920x1080	Ipqencoderwheelstatus	OK	
Hardwareconditionscrews	OK		Ipqencoderwheelrunningonweb	OK	
Hardwareconditioncables	OK		Alarmstatusindicator	OK	
Hardwareconditionconnectors	OK		Upsbatteryexchanged	NA	
Digitalcheckfan	OK		Upsdatebatteryexchanged		UPS builder recommand to exchange every 4 years.
Digitalreplacefilter	OK		Installation date:		2022-02-24
Traversecamera	OK		Upscommunicationchecking	OK	
Traversecameralenscleaning	OK		Softwareupdate	NA	
Traversewscamerareplaceflashbulb	NA	A faire a la prochaine maintenance	Version upgraded		
Traversewscameracleanwindows	OK		Softwareipqtcu		1.12
Camerachangefiltercheckfan	OK		Softwareipqwsc		1.9.6
Traversewscamerashadowreducingbackplate	OK		Softwareipqpps		2.2
Traversewscameracheckflashbulblackerflash	NA		Softwareipqili		1.4.3
Traversewscameracheckcleanmirrorlackercamera	NA		Softwareworkflowcommunication	NA	
Traversewscameracheckzoomirisfocuswscboard	OK	Changement de parametres possibilité de scanner code a barres sans problème	Softwareremote	OK	en VNC
Traversewscameracalibrationzoomirisfocus	OK		Operatorinstructions	NA	
Traversebackflash	NA		Backupscreenshots	OK	
Traversebackflashflashbulb	NA		Backupimage	NA	
Linecameracleanmirror	OK		Backupsoftware	OK	Reinstallation image + software suite a un problème de disque dur. Tout refonctionnent correctement.
Led checking+reflector checking+dome	OK				
Linecameramechanicalcheck	OK				
Linecamerabacklightmechanicalcheckjigs	OK				
Cameramechanicalalignementtoprint	OK				
Camerawhitecalibration	OK				

Comment(s)

(If fields are not visible please open PDF file with Google chrome or Microsoft edge nagivator or update your navigator)

Customer signature:

Name:

Date :


25/09/2024 12:12

BST eltromat FRANCE signature:

Name:

Date :


25/09/2024 18:05

ATTACHED PM'S FILE(S)

Calibrations et alignement	Filtres 100%
	