

BST Eltromat France SARL Impasse de la Noisette - CE402 F-91374 Verrières le Buisson Tél.: +33 1 69 20 07 41 Email: bstfrance@bst.group Web: https://www.bst.elexis.group/	Helios Périers ACU309170 M. Dupray Sebastien Route de Carentan 50190 Périers France +33 2 33 17 13 13 / +33 6 49 15 30 68 sdupray@helios-imp.com
--	---

Preventive reference number	PMREPORT-228_PM828_2025-03-03
Contract number / Numéro de contrat	CM1912027
Contract date:	2023/02/01 -> 2026/01/31
Machine customer name:	Biva 6 - CI30302
Assign to:	CouV
Material:	VIDEO_IPQ_Center
Type:	iPQ Center
SN:WA:	ASO026989 _ WA19538
Installation date of material:	2017/09/01

TECHNICAL DATAS

PC MODEL	IPC-BG-R7910/BSTE01.0
PC NAME	19538iPQ-Center1-1
ADDITIONAL CAMERA INFO	iPQ Center
OPERATION SYSTEM	WINDOWS EMBEDDED Standard
MEMORY RAM	32Go
FREE SPACE ON C	78.7 GB
FREE SPACE ON D	101 GB
TEAMVIEWER ID	966 125 751 / v12
IP ADDRESS EXTERN FOR INTERNET	192.168.55.23 255.255.255.0 192.168.55.6 192.168.55.6
ORIGINAL VERSION	2.17.9
UPG OR DNG VERSION DURING MAINTENANCE	No software upgrade recommended

Start time PM:	03/03/2025 13:30
End time PM:	03/03/2025 15:30

		COMMENTS			COMMENTS
Touchmonitorcalibration	✓		Ipqchecksynchronization	✓	
Pcscreenresolutiontouch		1920X1080	Ipqencoderwheelfixing	✓	
Pcscreenresolutionview		1920X1080	Ipqencoderwheelstatus	✓	
Hardwareconditionscrews	✓		Ipqencoderwheelrunningonweb	✓	
Hardwareconditioncables	✓		Alarmstatusindicator	✓	
Hardwareconditionconnectors	✓		Upsbatteryexchanged	✓	
Digitalcheckfan	✓		Upsdatebatteryexchanged		UPS builder recommand to exchange every 4 years.
Digitalreplacefilter	✓		Installation date:		2017-09-01 -> 07 YEAR(S)
Traversecamera	✓		Upscommunicationchecking	✓	
Traversecameralenscleaning	✓		Softwareupdate	⏸	
Traversewscamerareplaceflashbulb	⏸		Version upgraded		
Traversewscameracleanwindows	✓		Softwareipqtu		1.12
Camerachangefiltercheckfan	✓		Softwareipqwsc		1.9.6
Traversewscamerashadowreducingbackplate	⏸		Softwareipqpps		2.2
Traversewscameracheckflashbulblackerflash	⏸		Softwareipqili		1.4.3
Traversewscameracheckcleanmirrorlackercamera	⏸		Softwareworkflowcommunication	✓	
Traversewscameracheckzoomirisfocuswscboard	✓		Softwareremote	✓	
Traversewscameracalibrationzoomirisfocus	⏸		Operatorinstructions	⏸	
Traversebackflash	⏸		Backupscreenshots	✓	
Traversebackflashflashbulb	⏸		Backupimage	⏸	
Linecameracleanmirror	✓		Backupsoftware	⏸	
Led checking+reflector checking+dome	✗	Vernis sur le réflecteur du côté du back-flash, il faudrait remplacer le réflecteur			
Linecameramechanicalcheck	✓				
Linecamerabacklightmechanicalcheckjigs	✓				
Camera mechanicalalignementtoprint	✓				
Camera whitecalibration	✓				

✓: Checked, nothing to report / Vérifié, RAS

✗: Not OK, checked comment / Pas OK, vérifiez commentaires

⏸: Not actif / Non Actif

Comment(s)

(If fields are not visible please open PDF file with Google chrome or Microsoft edge nagivator or update your navigator)

Customer signature:

Name:

Date :

BST eltromat FRANCE signature:

Name:

Date :


06/03/2025 14:23


07/03/2025 09:36