

BST Eltromat France SARL Impasse de la Noisette - CE402 F-91374 Verrières le Buisson Tél.: +33 1 69 20 07 41 Email: bstfrance@bst.group Web: https://www.bst.elexis.group/	ALT Technologies M. Gido Lagro St.Laurensdreef 40 3565 AK Utrecht Netherlands +31 6 2518 9830 gido.lagro@alttechnologies.com
--	--

Preventive reference number	PMREPORT-340_PM980_2025-10-07
Contract number / Numéro de contrat	CM2201044
Contract date:	2022/04/01 -> 2025/03/31
Machine customer name:	Brotech FS330
Assign to:	DarA
Material:	VIDEO_Tubescan_DS
Type:	TubeScan DS 330 4000 / M2032a-C.0833
SN:WA:	ASO076553_42.1865
Installation date of material:	2021/12/14

TECHNICAL DATAS

PC MODEL	OptiPlex 7080 / Tag 4825MF3
PC NAME	Tubescan421865
ADDITIONAL CAMERA INFO	TubeScan DS 330 4000 / M2032a-C.0833
OPERATION SYSTEM	Windows 10 Pro / 22H2
MEMORY RAM	16GB (2x 8GB 3200 MHz)
FREE SPACE ON C	51.1 / 237 GB
FREE SPACE ON D	Brotech (\\vision-server\Vision) (Z:)
TEAMVIEWER ID	288 085 156 / v12
IP ADDRESS EXTERN FOR INTERNET	DHCP Automatic
ORIGINAL VERSION	7.4.35.87
UPGRADE OR DOWNGRADE VERSION LAST INTERVENTION	8.0.42.39529(hotfix11) from E2726
UPG OR DNG VERSION DURING MAINTENANCE	8.0.42.39529.hotfix-11

Start time PM:	07/10/2025 08:30
End time PM:	07/10/2025 17:30

COMMENTS			COMMENTS		
Touch monitor calibration	✓		Fixation encoder	✓	
Touch monitor resolution		1024x768	Encoder wheel status	✓	
View monitor resolution		1920X1080	Encoder wheel on web?	✗	Wheel on the exit roller
Fixation screws of system?	✓	UPS stabilized in a horizontal position	Spring(s) encoder status ?	✓	
Cables status ?	✓		Alarm indicator status ?	⏸	
Connectors cameras (well tight?)	✓		UPS battery exchanged ?	✗	
PC's fans ?	⏸		Date UPS's batteries exchanged ?		2024/10/30
PC's filter	⏸		Installation date:		2021-12-14 -> 00 YEAR(S)
Lens cleaning	✓		UPS communication?	✓	Eaton 5SC 750
Mirror cleaning	⏸	2 cameras looking down	Softwareworkflowcommunication	✓	
Backing or RRB cleaining	✓		Check Teamviewer access	✓	ID 288 085 156 / v15
Lens Focal	✓		Calibration of camera detail & 100%camera	⏸	
Camera alignement with printing	✓		Operators instruction ?	✓	
Check web under camera	✓		Screenshots	✓	On v8.0.42.39529.hotfix-11
Height compensator calib	✓		ACRONIS ?	✓	On v8.0.42.39529.hotfix-11
Encoder offset calib	✓		Backup application	✓	On v8.0.42.39529.hotfix-11
Only with EV- LED calibrations	⏸				
Kisspoint only with 2 cameras	✓				

Filled quantity needed for quotation:

(if fields are not visible please open PDF file with Google chrome or Microsoft edge navigator or update your navigator)

- ✓ ENCODER WHEEL:: 2RDHO234275
- ✓ LED Board equipped V40 L=140mm: 1ELLT256485
- ✓ LED Board equipped V40 L=160mm: 1ELLT256486
- ✓ ENCODER'S SPRING
- ✓ BACKPLATE W/B

- ✓: Checked, nothing to report / Vérifié, RAS
- ✗: Not OK, checked comment / Pas OK, vérifiez commentaires
- ⏸: Not actif / Non Actif

Comment(s)

(If fields are not visible please open PDF file with Google chrome or Microsoft edge navigator or update your navigator)

Preventive Maintenance Completed

- CR2032 motherboard battery replaced and BIOS reconfigured.
- Backup folders organized and cleaned to increase available disk space.
- Acronis on v8.0.42.39529.hotfix-11

Customer signature:

Name:

Date :

BST eltromat FRANCE signature:

Name:

Date :

07-Oct-25 1:54 PM

07-Oct-25 1:54 PM

ATTACHED PM'S FILE(S)

Picture 07102025	Screenshot 07102025
	