

BST Eltromat France SARL Impasse de la Noisette - CE402 F-91374 Verrières le Buisson Tél.: +33 1 69 20 07 41 Email: bstfrance@bst.group Web: https://www.bst.elxis.group/	Lysipack 231484 Gaëtan LIEVRE ZI de Merpins Avenue des Torulas, 16100 Merpins France 0033650887065 maintenance@lysipack.fr
--	---

Preventive reference number	PMREPORT-130_PM706_2024-08-29
Contract number / Numéro de contrat	CM2004030
Contract date:	2020/08/01 -> 2024/07/31
Machine customer name:	BOBST
Assign to:	DarA
Material:	VIDEO_IPQ_Center
Type:	iPQ Center
SN:WA:	WA021179_ASO067320
Origin BST France order:	202161
Installation date of material:	2020/08/14

CUSTOMER ORDER:	CDE CLIENT 24081901
-----------------	---------------------

TECHNICAL DATAS	
PC MODEL	IPC-BG-BKA-BSTE01.0-3
PC NAME	21179iPQ-Center1-1
ADDITIONAL CAMERA INFO	iPQ Center
OPERATION SYSTEM	Windows 10 Enterprise 2016 LTSB
MEMORY RAM	32 GB
FREE SPACE ON C	51.1 / 75.7 GB
FREE SPACE ON D	F:\ 1.74 / 1.81 TB
TEAMVIEWER ID	109 946 464 / v15
IP ADDRESS EXTERN FOR INTERNET	IP : 192.168.1.21 Sous réseau : 255.255.0.0 Passerelle : 192.168.1.1 DNS : 8.8.8.8 DNS Aux : 8.8.4.4
ORIGINAL VERSION	2.17.9
UPG OR DNG VERSION DURING MAINTENANCE	No software upgrade recommended

		COMMENTS			COMMENTS
Touchmonitorcalibration	NA	Calibration ok	Ipqchecksynchronization	OK	
Pcscreenresolutiontouch		1920X1080	Ipqencoderwheelfixing	OK	
Pcscreenresolutionview		1920X1080	Ipqencoderwheelstatus	OK	
Hardwareconditionscrews	OK		Ipqencoderwheelrunningonweb	OK	
Hardwareconditioncables	OK		Alarmstatusindicator	OK	
Hardwareconditionconnectors	OK		Upsbatteryexchanged	NA	
Digitalcheckfan	OK		Upsdatebatteryexchanged		UPS builder recommand to exchange every 4 years.
Digitalreplacefilter	OK	2 Filters	Installation date:		2020-08-14 -> 04 YEAR(S)
Traversecamera	OK		Upscommunicationchecking	OK	
Traversecameralenscleaning	OK		Softwareupdate	NA	Need new image for software upgrade
Traversewscamerareplaceflashbulb	OK	8 Flash Bulbs + Calibration	Version upgraded		
Traversewscameracleanwindows	OK		Softwareipqtcu		1.12
Camerachangefiltercheckfan	OK	2 Filters	Softwareipqwsc		1.9.6
Traversewscamerashadowreducingbackplate	OK		Softwareipqpps		2.2
Traversewscameracheckflashbulblackerflash	NA		Softwareipqili		1.4.3
Traversewscameracheckcleanmirrorlackercamera	NA		Softwareworkflowcommunication	NA	
Traversewscameracheckzoomirisfocuswscboard	OK		Softwareremote	OK	
Traversewscameracalibrationzoomirisfocus	OK		Operatorinstructions	NA	
Traversebackflash	NA		Backupscreenshots	OK	
Traversebackflashflashbulb	NA		Backupimage	OK	Spare SSD drive done
Linecameracleanmirror	OK		Backupsoftware	OK	ipq-center_bak_2024_08_29_11_55_37.zip
Led checking+reflector checking+dome	OK	Varnish creates small filaments on the Frot Light between the two cameras (Vertical lines visible in production: Cleaned			
Linecameramechanicalcheck	OK				
Linecamerabacklightmechanicalcheckjigs	OK				
Camera mechanicalalignementtoprint	OK				
Camera whitecalibration	OK				

Comment(s)

(If fields are not visible please open PDF file with Google chrome or Microsoft edge navigator or update your navigator)

Preventive Maintenance on iPQ Center following the check list.
Varnish creates small filaments on the Front Light between the two cameras (Vertical lines visible).Solved.
Calibration plate must be replace for next visite.

Customer signature:

Name: **M. Costel NICULESCU**

Date : **29/08/2024**



jeudi 29 août 2024 12:15:27

BST eltromat FRANCE signature:

 
 
 
Name: **M. Arnaud DARCEL**

Date : **29/08/2024**



jeudi 29 août 2024 12:15:43

ATTACHED PM'S FILE(S)

Offre_PR 240814-0171 	CDE CLIENT 24081901 	BL2408-0212 	sysconfig-Setup-Camera-Whitefader BC 	sysconfig-Setup-Camera-Whitefader AC 
sysconfig-Setup-Camera-Iris 	sysconfig-Setup-Camera- Zoom 	sysconfig-Setup-LineCam-imp0- Align 	sysconfig-Setup-LineCam-imp1- Align 	sysconfig-Setup-LineCam-imp0-Gain 
sysconfig-Setup-LineCam-imp1- Gain 	FOV After Gain calibration 	UPS 	Teamviewer v15 	Win-HDD 