

BST Eltromat France SARL Impasse de la Noisette - CE402 F-91374 Verrières le Buisson Tél.: +33 1 69 20 07 41 Email: bstfrance@bst.group Web: https://www.bst.elexis.group/	Emsur S.p.o 231357 Cyrille Jaguelin / Frédéric Bruant Rue Julienne Robert 53340 Ballée France +33 243 64 36 85 cyrille.jaguelin@emsur.com / frederic.bruant@emsur.com
--	--

Preventive reference number	PMREPORT-242_PM855_2025-03-27
Contract number / Numéro de contrat	CM1709009
Contract date:	2021/01/01 -> 2024/12/31
Machine customer name:	F83
Assign to:	CouV
Material:	VIDEO_IPQ_Center
Type:	iPQ Center / Dual Head Varnish
SN:WA:	ASO056723 _ WA19752
Origin BST France order:	192161
Installation date of material:	2017/07/01

TECHNICAL DATAS

PC MODEL	IPC-BG-BKA-BSTE01.0-3
PC NAME	19752iPQ-Center1-1
ADDITIONAL CAMERA INFO	iPQ Center / Dual Head Varnish
OPERATION SYSTEM	Windows 10 Entreprise 2016 LTSC
MEMORY RAM	32 GB
FREE SPACE ON C	51.2 - 75.7 GB
FREE SPACE ON D	F:\ 1.71 / 1.81 TB
TEAMVIEWER ID	1 248 594 841 / v15
IP ADDRESS EXTERN FOR INTERNET	IP address : 192.1.1.140 Subnet mask : 255.255.254.0 Default gateway : 192.1.1.252 Preferred DNS server : 192.1.1.5 Alternet DNS server : 192.1.1.1
ORIGINAL VERSION	2.17.9
UPG OR DNG VERSION DURING MAINTENANCE	2.17.9

Start time PM:	27/03/2025 12:38
End time PM:	

		COMMENTS			COMMENTS
Touchmonitorcalibration	✓		Ipqchecksynchronization	✓	
Pcscreenresolutiontouch		1920x1080	Ipqencoderwheelfixing	✓	
Pcscreenresolutionview		1920x1080	Ipqencoderwheelstatus	✓	
Hardwareconditionscrews	✓		Ipqencoderwheelrunningonweb	✓	
Hardwareconditioncables	✓		Alarmstatusindicator	✓	
Hardwareconditionconnectors	✓		Upsbatteryexchanged	⏸	
Digitalcheckfan	✓		Upsdatebatteryexchanged		UPS builder recommend to exchange every 4 years.
Digitalreplacefilter	✓		Installation date:		2017-07-01 -> 07 YEAR(S)
Traversecamera	✓		Upscommunicationchecking	✓	
Traversecameralenscleaning	✓		Softwareupdate	⏸	
Traversewscamerareplaceflashbulb	⏸	A remplacer au prochain préventif, surtout cam recto, voir photos	Version upgraded		2.17.9
Traversewscameracleanwindows	✓		Softwareipqtcu		1.12
Camerachangefiltercheckfan	✓		Softwareipqwsc		1.9.6
Traversewscamerashadowreducingbackplate	✓		Softwareipqpps		2.2
Traversewscameracheckflashbulblackerflash	✓		Softwareipqili		1.4.3
Traversewscameracheckcleanmirrorlackercamera	✓		Softwareworkflowcommunication	✓	
Traversewscameracheckzoomirisfocuswscboard	⏸		Softwareremote	✓	
Traversewscameracalibrationzoomirisfocus	⏸		Operatorinstructions	⏸	
Traversebackflash	✓		Backupscreenshots	✓	
Traversebackflashflashbulb	⏸		Backupimage	⏸	
Linecameracleanmirror	✓		Backupsoftware	⏸	
Led checking+reflector checking+dome	✗	Backflash rayé			
Linecameramechanicalcheck	✓				
Linecamerabacklightmechanicalcheckjigs	✓				
Camera mechanicalalignementtoprint	✓				
Camera whitecalibration	✓				

- ✓: Checked, nothing to report / Vérifié, RAS
 ✗: Not OK, checked comment / Pas OK, vérifiez commentaires
 ⏸: Not actif / Non Actif

Comment(s)

(If fields are not visible please open PDF file with Google chrome or Microsoft edge nagivator or update your navigator)

Test du PDF compare OK, mais pas de fichier fonctionnel.
Flash matricielle à remplacer au prochain prøventif.

Customer signature:

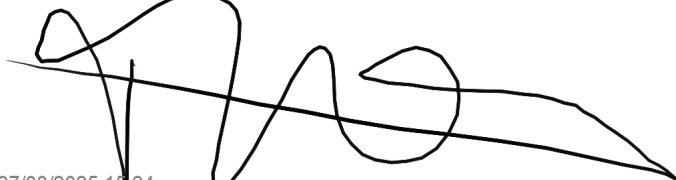
Name: **Mongazon Pascal**

Date :

BST eltromat FRANCE signature:

Name: **Coutellier Vivien**

Date :


27/03/2025 15:24


27/03/2025 15:02

ATTACHED PM'S FILE(S)

