

BST Eltromat France SARL Impasse de la Noisette - CE402 F-91374 Verrières le Buisson Tél.: +33 1 69 20 07 41 Email: bstfrance@bst.group Web: https://www.bst.elexis.group/	Wipak 231056 M. Eric Ghesquier Drèce des Bois 59166 Bousbecque France +33 6 07 01 64 56 eric.ghesquier@wipak.com
--	---

Preventive reference number	PMREPORT-372_PM1016_2025-11-18
Contract number / Numéro de contrat	CM2005031
Contract date:	2023/10/01 -> 2026/09/30
Machine customer name:	Grafomac
Assign to:	DarA
Material:	VIDEO_IPQ_Center
Type:	IPQ Center
SN:WA:	ASO067953 _ WA0021190
Installation date of material:	2020/09/23

TECHNICAL DATAS

PC MODEL	beg-BKA-BST01
PC NAME	21190IPQ-Center1-1
ADDITIONAL CAMERA INFO	IPQ Center
OPERATION SYSTEM	Windows 10 Enterprise 2016 LTSB / 2016
MEMORY RAM	32 GB
FREE SPACE ON C	51.5 / 75.7 GB
FREE SPACE ON D	Protocol Hd (F:) 1.68 / 1.81 TB
TEAMVIEWER ID	212 661 068 / v15
IP ADDRESS EXTERN FOR INTERNET	IP Address : 192.168.1.59 Subnet mask : 255.255.255.0 Default gateway : 192.168.1.1 Preferred DNS server : 8.8.8.8 Alternate DNS server : 8.8.4.4
ORIGINAL VERSION	2.17.9
UPG OR DNG VERSION DURING MAINTENANCE	No software upgrade recommended

Start time PM:	18/11/2025 13:15
End time PM:	18/11/2025 17:00

		COMMENTS			COMMENTS
Touchmonitorcalibration	✓		Ipqchecksynchronization	✓	
Pcscreenresolutiontouch		1920x1080 - 24"	Ipqencoderwheelfixing	✓	
Pcscreenresolutionview		1920x1080 - 43"	Ipqencoderwheelstatus	✓	
Hardwareconditionscrews	✓		Ipqencoderwheelrunningonweb	✓	
Hardwareconditioncables	✓		Alarmstatusindicator	✓	
Hardwareconditionconnectors	✓		Upsbatteryexchanged	✓	- Software "euc_win_2_00_025" installed and configured for UPS Eaton.
Digitalcheckfan	✓		Upsdatebatteryexchanged		2024/12/18
Digitalreplacefilter	✓		Installation date:		2020-09-23 -> 00 YEAR(S)
Traversecamera	✓		Upscommunicationchecking	✓	
Traversecameralenscleaning	✓		Softwareupdate	⏸	Last released version on this base image
Traversewscamerareplaceflashbulb	⏸	Will be replaced during next maintenance	Version upgraded		
Traversewscameracleanwindows	✓		Softwareipqtcu		1.12
Camerachangefiltercheckfan	✓		Softwareipqwsc		1.9.6
Traversewscamerashadowreducingbackplate	✓		Softwareipqpps		2.2
Traversewscameracheckflashbulblackerflash	✗	Will be replaced during next maintenance	Softwareipqjli		1.4.3
Traversewscameracheckcleanmirrorlackercamera	✓		Softwareworkflowcommunication	⏸	
Traversewscameracheckzoomirisfocuswsboard	✓		Softwareremote	✓	
Traversewscameracalibrationzoomirisfocus	✓		Operatorinstructions	⏸	
Traversebackflash	⏸		Backupscreenshots	✓	
Traversebackflashflashbulb	✓		Backupimage	✓	
Linecameracleanmirror	✓		Backupsoftware	✓	
Led checking+reflector checking+dome	✓				
Linecameramechanicalcheck	✓				
Linecamerabacklightmechanicalcheckjigs	✓				
Cameraalignmenttoprint	✓				
Camerawhitecalibration	✓				

- ✓: Checked, nothing to report / Vérifié, RAS
✗: Not OK, checked comment / Pas OK, vérifiez commentaires
⏸: Not actif / Non Actif

Comment(s)

(If fields are not visible please open PDF file with Google chrome or Microsoft edge nagivator or update your navigator)

Preventive Maintenance Completed.

- Software "euc_win_2_00_025" installed and configured for UPS Eaton.

Customer signature:

Name: M. David Durand

Date : 18/11/2025

BST eltromat FRANCE signature:

Name: M. Arnaud Darcel

Date : 18/11/2025

 
 
 


18-Nov-25 5:38 PM



18-Nov-25 5:38 PM

ATTACHED PM'S FILE(S)

Picture 18112025 	sysconfig-Setup-Camera-Whitefader-BC 	sysconfig-Setup-Camera-Whitefader-AC 	sysconfig-Setup-Camera-Iris 	sysconfig-Setup-Camera-Zoom 
sysconfig-Setup-LineCam-ipm0-AC 	sysconfig-Setup-LineCam-ipm1-AC 	Screenshot 18112025 		