

BST Eltromat France SARL Impasse de la Noisette - CE402 F-91374 Verrières le Buisson Tél.: +33 1 69 20 07 41 Email: bstfrance@bst.group Web: https://www.bst.elxis.group/	Emsur S.p.o 231357 Cyrille Jaguelin / Frédéric Bruant Rue Julienne Robert 53340 Ballée France +33 243 64 36 85 cyrille.jaguelin@emsur.com / frederic.bruant@emsur.com
--	---

Preventive reference number	PMREPORT-124_PM698_2024-08-08
Contract number / Numéro de contrat	CM1709009
Contract date:	2021/01/01 -> 2024/12/31
Machine customer name:	F83
Assign to:	DarA
Material:	VIDEO_IPQ_Center
Type:	iPQ Center / Dual Head Varnish
SN:WA:	ASO056723 _ WA19752
Origin BST France order:	192161
Installation date of material:	2017/07/01

CUSTOMER ORDER:	CDE CLIENT 10402
-----------------	------------------

TECHNICAL DATAS

PC MODEL	IPC-BG-BKA-BSTE01.0-3
PC NAME	19752iPQ-Center1-1
ADDITIONAL CAMERA INFO	iPQ Center / Dual Head Varnish
OPERATION SYSTEM	Windows 10 Entreprise 2016 LTSB
MEMORY RAM	32 GB
FREE SPACE ON C	51.2 - 75.7 GB
FREE SPACE ON D	F:\ 1.71 / 1.81 TB
TEAMVIEWER ID	1 248 594 841 / v15
IP ADDRESS EXTERN FOR INTERNET	IP address : 192.1.1.140 Subnet mask : 255.255.254.0 Default gateway : 192.1.1.252 Preferred DNS server : 192.1.1.5 Alternet DNS server : 192.1.1.1
ORIGINAL VERSION	2.17.9
UPG OR DNG VERSION DURING MAINTENANCE	2.17.9

		COMMENTS			COMMENTS
Touchmonitorcalibration	OK		Ipqchecksynchronization	OK	
Pcscreenresolutiontouch		1920x1080	Ipqencoderwheelfixing	OK	
Pcscreenresolutionview		1920x1080	Ipqencoderwheelstatus	OK	
Hardwareconditionscrews	OK		Ipqencoderwheelrunningonweb	OK	
Hardwareconditioncables	OK		Alarmstatusindicator	OK	
Hardwareconditionconnectors	OK		Upsbatteryexchanged	KO	
Digitalcheckfan	OK	On cabinet	Upsdatebatteryexchanged		UPS builder recommand to exchange every 4 years.
Digitalreplacefilter	OK		Installation date:		2017-07-01 -> 07 YEAR(S)
Traversecamera	OK		Upscommunicationchecking	OK	After Eaton software reinstalled
Traversecameralenscleaning	OK		Softwareupdate	KO	
Traversewscamerareplaceflashbulb	KO	Done previous PM - ASO103234 : 2x WSC-MFL.1 replaced on Front Camera	Version upgraded		2.17.9
Traversewscameracleanwindows	OK		Softwareipqtcu		1.12
Camerachangefiltercheckfan	OK	2 filters	Softwareipqwsc		1.9.6
Traversewscamerashadowreducingbackplate	KO	Dirty	Softwareipqpps		2.2
Traversewscameracheckflashbulblackerflash	KO	No need	Softwareipqli		1.4.3
Traversewscameracheckcleanmirrorlackercamera	OK		Softwareworkflowcommunication	OK	Quality Assistant v2.9.6
Traversewscameracheckzoomirisfocuswscboard	OK		Softwareremote	OK	
Traversewscameracalibrationzoomirisfocus	OK	White fader + Iris	Operatorinstructions	KO	Press stopped for weeks
Traversebackflash	OK		Backupscreenshots	OK	
Traversebackflashflashbulb	OK		Backupimage	KO	Already done on this Base Image
Linecameracleanmirror	OK		Backupsoftware	OK	
Led checking+reflector checking+dome	OK	Dirty			
Linecameramechanicalcheck	OK				
Linecamerabacklightmechanicalcheckjigs	OK	White fader + Iris			
Camera mechanicalalignementtoprint	OK				
Camera whitecalibration	OK				

Comment(s)

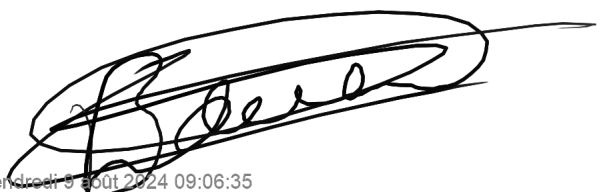
(If fields are not visible please open PDF file with Google chrome or Microsoft edge nagivator or update your navigator)

Maintenance préventive du système iQ Center. 2 Cartes WSC.MFL.1 commandé le 13/12/2023 remplacées sur Caméra Recto... 8 Flash Bulbs opérationnels et calibrés.
16 Flash Bulbs de la même commande (Offre PR231127 / CDE CLIENT 10402) ont été remplacées lors de la PM583. Onduleur actif après réinstallation et configuration.

Customer signature:

Name: **Frédéric Bruant**

Date : **09/08/2024**


vendredi 9 août 2024 09:06:35

 
 
BST eltromat FRANCE signature:

Name: **Arnaud Darcel**

Date : **09/08/2024**


vendredi 9 août 2024 09:06:57

ATTACHED PM'S FILE(S)

Offre PR231127 	CDE CLIENT 10402 	BL2312-0140 	sysconfig-Setup-Camera-Whitfader-BC 	sysconfig-Setup-Camera-Whitfader-AC 
sysconfig-Setup-Camera-Iris 	sysconfig-Setup-LineCam-imp0-Plate-AC 	sysconfig-Setup-LineCam-imp0-Plate-BC 	sysconfig-Setup-LineCam-imp1-Plate-AC 	sysconfig-Setup-LineCam-imp1-Plate-BC 
sysconfig-Setup-LineCam-imp0-imp1-PRNU-BC 	sysconfig-Setup-LineCam-imp0-PRNU-AC 	sysconfig-Setup-LineCam-imp1-PRNU-AC 	Screenshot 08082024 	Picture 08082024 