

BST Eltromat France SARL Impasse de la Noisette - CE402 F-91374 Verrières le Buisson Tél.: +33 1 69 20 07 41 Email: bstfrance@bst.group Web: https://www.bst.elexis.group/	Elopak Morocco XXX Mr Abdelmajid Ihyaoui Sapino 783 parc industriel de Nouaceur 27182 Nouaceur Maroc +212 5 22 01 40 28 / +212 6 61 92 56 83 abdelmajid.ihyaoui@elopak.com
--	---

Preventive reference number	PMREPORT-307_PM944_2025-07-08
Contract number / Numéro de contrat	CM2402061
Contract date:	2025/02/01 -> 2028/01/31
Machine customer name:	Ligne 2
Assign to:	DarA
Material:	VIDEO_IPQ_View
Type:	IPQ VIEW
SN:WA:	ASO038993_WA0019990
Installation date of material:	

CUSTOMER ORDER:	CDE CLIENT 55105954
-----------------	---------------------

TECHNICAL DATAS

PC MODEL	XE2-i5-4570S
PC NAME	19990iPQ-Center1-1
ADDITIONAL CAMERA INFO	IPQ VIEW
OPERATION SYSTEM	Windows Embedded Standard SP1
MEMORY RAM	8 GB
FREE SPACE ON C	22.9 / 48.8 GB
FREE SPACE ON D	F: 202 / 216 GB
TEAMVIEWER ID	301 896 208 / v15
IP ADDRESS EXTERN FOR INTERNET	Automatic IP
ORIGINAL VERSION	2.17.9
UPG OR DNG VERSION DURING MAINTENANCE	No software upgrade recommended

Start time PM:	08/07/2025 08:30
End time PM:	08/07/2025 12:30

		COMMENTS			COMMENTS
Touchmonitorcalibration	✓	Screen marked (Ghost effect)	Ipqchecksynchronization		
Pcscreenresolutiontouch		1920x1082	Ipqencoderwheelfixing	⏸	
Pcscreenresolutionview			Ipqencoderwheelstatus	⏸	
Hardwareconditionscrews	✓		Ipqencoderwheelrunningonweb	⏸	
Hardwareconditioncables	✓		Alarmstatusindicator	⏸	
Hardwareconditionconnectors	✓		Upsbatteryexchanged	✓	New UPS (5E 900 USB FR G2 (9C00-53246))
Digitalcheckfan	✓		Upsdatebatteryexchanged		UPS builder recommand to exchange every 4 years.
Digitalreplacefilter	✓		Installation date:		-> 00 YEAR(S)
Traversecamera	✓		Upscommunicationchecking	✓	
Traversecameralenscleaning	✓		Softwareupdate	✓	Last version on this Base Image
Traversewscamerareplaceflashbulb	✓	8 Flash Bulbs replaced	Version upgraded		
Traversewscameracleanwindows	✓		Softwareipqtcu		1.12
Camerachangefiltercheckfan	✓		Softwareipqwsc		1.9.6
Traversewscamerashadowreducingbackplate	✗	Too dirty but not really needed (Carton product)	Softwareipqpps		-
Traversewscameracheckflashbulblackerflash	⏸		Softwareipqjli		-
Traversewscameracheckcleanmirrorlackercamera	⏸		Softwareworkflowcommunication	⏸	
Traversewscameracheckzoomirisfocuswscboard	✓		Softwareremote	✗	
Traversewscameracalibrationzoomirisfocus	✓		Operatorinstructions	⏸	Need to plug cable
Traversebackflash	⏸		Backupscreenshots	✓	
Traversebackflashflashbulb	✓		Backupimage	✓	Done on this version already
			Backupsoftware	✓	ipq-center_bak_2025_07_08_10_47_26

- ✓: Checked, nothing to report / Vérifié, RAS
✗: Not OK, checked comment / Pas OK, vérifiez commentaires
⏸: Not actif / Non Actif

Comment(s)

(If fields are not visible please open PDF file with Google chrome or Microsoft edge navigator or update your navigator)

Preventive Maintenance - 8 Flash Bulbs replaced (Include in contract)

Customer signature:

 
Name:

Date :

BST eltromat FRANCE signature:

Name:

Date :



08-Jul-25 6:02 PM




08-Jul-25 6:02 PM

ATTACHED PM'S FILE(S)


[Picture 08072025](#)



 
[sysconfig-Setup-Camera-Whitefader AC](#)



[sysconfig-Setup-Camera-Iris](#)

 

[sysconfig-Setup-Camera-Zoom](#)

 

[Full View - BPM 40](#)



[Full View - APM 40](#)



[Screenshot 08072025](#)

