

On Customer Site

Visit Report

Reference :

Commande BSTe France : CM2105039		Commande BSTe Int. : PM275	
Customer :	Etik Ouest (Soullans)	System :	Helios II 445mm
Customer Contact :	M. Sylvian Gandemer	SN :	215003
Customer Order number :	CM2105039 Signé	Machine Nickname :	F7

Visit Purpose :

Mechanical Preparation	☐	Installation	☐	Start-up	☐
Maintenance	☒	Under Contract	☒	Out of Contract	☐
Troubleshoot	☐	Under Warranty	☐	Out of Warranty	☐
Instruction	☐ Yes				
	☒ No				

	13/12/2021					
Travel To	5.5					
Start Time	14h00					
Lunch Time	0					
End Time	17h30					
Travel From	0.5					

Details	Maintenance Préventive du système Helios II 445mm sur machin F7 suivant check list.
---------	---

Purpose of the visit completed : Yes ☒ No ☐

Need a new visit : Yes ☐ No ☒

On Customer Site

Maintenance Checklist for Inspection Systems

Available supporting documents :

- Maintenance instruction for Digital Strobe & EagleView systems
- Check list for maintenance

Customer name and place : [Etik Ouest / ZA, Route des Borgnières – 85300 - Soullans](#)

Contact person at customer : [M. Sylvain Gandemer](#)

Customer Mail & Mobile/Landline : sgandemer@etikouest.com / +33 2 51 49 17 27

System Type : [Helios II 445mm](#)

SN : [215003](#)

Machine Manufacturer/Model/Nickname : [Gallus / EM410 / F7](#)

Date : [15/12/2021](#)

Name : [Arnaud Darcel](#)


Comments :

Signatures :



Arnaud Darcel 2021-12-15T11:11:13+01:00

BST eltromat FSE

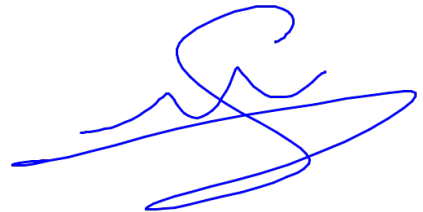

Sylvain Gandemer 2021-12-15T11:10:58+01:00

Customer

On Customer Site

Prior to a Preventive Maintenance :

Check with customer about problems, or failure with the system.

1. Cleaning the optical parts :

OK/NA

- Mirror cleaned with ZEISS lens wipes. ☒ ☐
- Camera lens cleaned with ZEISS lens wipes. ☒ ☐
- Reflectors cleaned with soft cloth using iso propanol or alcohol. ☒ ☐
- Back plate cleaned. ☒ ☐
- Computer filter cleaned/replaced ☒ ☐

2. Camera calibration :

OK/NA

- Field of View / Period 10.05 : [542.00 mm](#) ☒ ☐
- Offset/Gain Calibration : [105/123/121 – 41/45/40 – 6/5/5 \(White LF\)](#) ☒ ☐
- Zero LED calibration : Anyspeed & Zero Signal : [AnySpeed 132 / Position 133](#) ☒ ☐

3. Check functioning of the Lamps :

OK/NA

- Lamps replacement. : [Qty x4 - 23720009](#) ☒ ☐
- Brightness and uniformity of the image checked. ☒ ☐

4. Replacement of the encoder wheel :

OK/NA

- Encoder wheel replaced and tightened ☐ ☐
- Spring replaced (if necessary) and spring force checked (ca. 1kg/10N) ☐ ☐

5. Software update :

OK/NA

- Software Update (if necessary). ☐ ☐

Old SW version : [5.5.1.#35](#)

New SW version : [5.5.1.#35](#)

On Customer Site

6. Final check of the running system :

OK/NA

- Stability of live image checked (without reference image). ☒ ☐
- Stripe alignment checked (Normal and reflective mode). ☒ ☐
- Registration checked. ☒ ☐
- Maximum speed checked. ☒ ☐
- Hard drive capacity checked. ☒ ☐
- Backup created and saved locally and/or on USB stick. ☒ ☐

7. Backup :

OK/NA

- BackupRestore ☒ ☐
- Archive Printflow ☒ ☐
- Acronis ☒ ☐

Parts replaced during Preventive Maintenance :

- 1 - [Lamps 23720009 Qty 4](#) 3 -
- 2 - [SOB filter](#) 4 -

Parts suggested to replace during the next Maintenance :

- 1 - 3 -
- 2 - 4 -

Part need to be replaced as soon as possible :

- 1 - 3 -
- 2 - 4 -

On Customer Site

Technical datas

Computer name : [AVT-F7](#)

Total Physical Memory : [16 GB](#)

Free Space in C Drive (System) : [28.7 GB](#)

Free Space in D Drive : [387 GB](#)

Free Space in F Drive (Backup) : [369 GB](#)

OS : [Windows Embedded Standard SP1 v7.740](#)

Screen Resolution Touch : [1920x1080](#)

Computer Model : [95203672 / X79TO](#)

Date : [Sep, 2016](#)

Remote Maintenance (Teamviewer)

IP address : [\(DHCP Automatic\)](#)

Subnet mask :

Default gateway :

Preferred DNS server :

Alternate DNS server :

Teamviewer ID / Version : [326 025 993 / v12](#)

On Customer Site

Notes
