

BST Eltromat France SARL Impasse de la Noisette - CE402 F-91374 Verrières le Buisson Tél.: +33 1 69 20 07 41 Email: bstfrance@bst.group Web: https://www.bst.elexis.group/	Amcor (Sarrebourg) 231254 M. Thierry Richard 48 rue de Sarreguemines 57400 Sarrebourg France +33 3 87 24 53 43 thierry.richard@amcor.com
--	---

Preventive reference number	PMREPORT-254_PM863_2025-04-09
Contract number / Numéro de contrat	Please fill system information
Contract date:	
Machine customer name:	249
Assign to:	CouV
Material:	VIDEO_IPQ_Center
Type:	iPQ Center
SN:WA:	ASO065990_WA0021130
Installation date of material:	2020/08/07

TECHNICAL DATAS

PC MODEL	IPC-BG-BKA-BSTE01.0-3
PC NAME	21130IPQ-CENTER
ADDITIONAL CAMERA INFO	iPQ Center
OPERATION SYSTEM	Windows 10 Entreprise 2016 LTSC
MEMORY RAM	32 GB
FREE SPACE ON C	51.5 GB
FREE SPACE ON D	91.8 GB
TEAMVIEWER ID	1 942 217 908 / v12
IP ADDRESS EXTERN FOR INTERNET	
ORIGINAL VERSION	2.17.6
UPG OR DNG VERSION DURING MAINTENANCE	2.17.7

Start time PM:	07/04/2025 13:50
End time PM:	

		COMMENTS			COMMENTS
Touchmonitorcalibration	✓		Ipqchecksynchronization	✓	
Pcscreenresolutiontouch		1920x1080	Ipqencoderwheelfixing	✓	
Pcscreenresolutionview		1920x1080	Ipqencoderwheelstatus	✓	
Hardwareconditionscrews	✓		Ipqencoderwheelrunningonweb	✓	
Hardwareconditioncables	✓		Alarmstatusindicator	✓	
Hardwareconditionconnectors	✓		Upsbatteryexchanged	⏸	
Digitalcheckfan	✓		Upsdatebatteryexchanged		UPS builder recommend to exchange every 4 years.
Digitalreplacefilter	✓		Installation date:		2020-08-07 -> 04 YEAR(S)
Traversecamera	✓		Upscommunicationchecking	✓	
Traversecameralenscleaning	✓		Softwareupdate	⏸	
Traversewscamerareplaceflashbulb	✓		Version upgraded		2.17.7
Traversewscameracleanwindows	✓		Softwareipqtcu		1.12
Camerachangefiltercheckfan	✓		Softwareipqwsc		1.9.5
Traversewscamerashadowreducingbackplate	⏸		Softwareipqpps		2.2
Traversewscameracheckflashbulblackerflash	✓		Softwareipqili		1.4.3
Traversewscameracheckcleanmirrorlackercamera	✓		Softwareworkflowcommunication	✓	
Traversewscameracheckzoomirisfocuswscboard	✓		Softwareremote	✗	
Traversewscameracalibrationzoomirisfocus	✓		Operatorinstructions	⏸	
Traversebackflash	✓		Backupscreenshots	✓	
Traversebackflashflashbulb	⏸		Backupimage	⏸	
Linecameracleanmirror	✗	Présence de produit corrosif sur les miroirs, les miroirs sont très marqués même après nettoyage.	Backupsoftware	✓	
Led checking+reflector checking+dome	✗	dôme craquelé			
Linecameramechanicalcheck	✓				
Linecamerabacklightmechanicalcheckjigs	✓				
Camera mechanicalalignementtoprint	✓				
Camera whitecalibration	✗	Calibration faite mais quelques traits sont visibles dû à l'état des miroir.			

- ✓: Checked, nothing to report / Vérifié, RAS
 ✗: Not OK, checked comment / Pas OK, vérifiez commentaires
 ⏸: Not actif / Non Actif

Comment(s)

(If fields are not visible please open PDF file with Google chrome or Microsoft edge nagivator or update your navigator)

Customer signature:

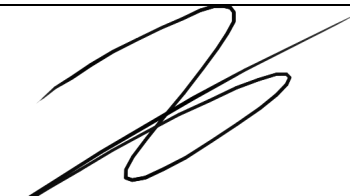
Name:

Date :

BST eltromat FRANCE signature:

Name:

Date :


 10/04/2025 12:25

ATTACHED PM'S FILE(S)

