

BST Eltromat France SARL Impasse de la Noisette - CE402 F-91374 Verrières le Buisson Tél.: +33 1 69 20 07 41 Email: bstfrance@bst.group Web: https://www.bst.elexis.group/	CCL Package Label - Pharma (Chilly-Mazarin) ACU231910 M. Jean-Charles Campana 20 Avenue Arago 91380 Chilly-Mazarin France +33 7 63 04 72 66 jccampana@cclind.com
--	---

Preventive reference number	PMREPORT-361_PM1005_2025-11-06
Contract number / Numéro de contrat	CM1708005
Contract date:	2022/01/01 -> 2024/12/31
Machine customer name:	Presse 285
Assign to:	DarA
Material:	VIDEO_Tubescan_DS
Type:	TubeScan DS 330 4K / BF3-M2-0.0833
SN:WA:	ASO058488_40.1209
Installation date of material:	2019/08/19

TECHNICAL DATAS

PC MODEL	OptiPlex 5060 / Tag 70RR9W2
PC NAME	TubeScan401209
ADDITIONAL CAMERA INFO	TubeScan DS 330 4K / BF3-M2-0.0833
OPERATION SYSTEM	Windows 10 Pro / 2018
MEMORY RAM	16 GB
FREE SPACE ON C	178 / 237 GB
FREE SPACE ON D	-
TEAMVIEWER ID	770 754 848 / v12
IP ADDRESS EXTERN FOR INTERNET	Automatic IP
ORIGINAL VERSION	7.4.44.111
UPG OR DNG VERSION DURING MAINTENANCE	7.4.67.34209

Start time PM:	06/11/2025 14:30
End time PM:	06/11/2025 17:00

COMMENTS			COMMENTS		
Touch monitor calibration	✓		Fixation encoder	✓	
Touch monitor resolution		1024x768 - 15.5"	Encoder wheel status	✓	
View monitor resolution		1920x1080 - 21.5"	Encoder wheel on web?	✓	
Fixation screws of system?	✓		Spring(s) encoder status ?	✓	
Cables status ?	✓		Alarm indicator status ?	✓	
Connectors cameras (well tight?)	✓		UPS battery exchanged ?	✗	
PC's fans ?	✓		Date UPS's batteries exchanged ?		OLD UPS APC NEW UPS EATON recommand to exchange every 5 years.
PC's filter	⏸		Installation date:		2019-08-19 -> 06 YEAR(S)
Lens cleaning	✓	1 camera looking up	UPS communication?	✗	
Mirror cleaning	✓		Softwareworkflowcommunication	⏸	
Backing or RRB cleaining	✓		Check Teamviewer access	✗	770 754 848 / v12 No RJ45 cable
Lens Focal	✓		Calibration of camera detail & 100%camera	⏸	
Camera alignment with printing	✓		Operators instruction ?	⏸	
Check web under camera	✓		Screenshots	✓	On v7.4.67.34209
Height compensator calib	✓		ACRONIS ?	✓	On v7.4.67.34209
Encoder offset calib	✓		Backup application	✓	On v7.4.67.34209
Only with EV- LED calibrations	⏸				
Kisspoint only with 2 cameras	⏸				

Filled quantity needed for quotation:

(if fields are not visible please open PDF file with Google chrome or Microsoft edge navigator or update your navigator)

- ✓ ENCODER WHEEL:: 2RDHO234275
- ✓ LED Board equipped V40 L=140mm: 1ELLT256485
- ✓ LED Board equipped V40 L=160mm: 1ELLT256486
- ✓ ENCODER'S SPRING
- ✓ BACKPLATE W/B

- ✓: Checked, nothing to report / Vérifié, RAS
- ✗: Not OK, checked comment / Pas OK, vérifiez commentaires
- ⏸: Not actif / Non Actif

Comment(s)

(If fields are not visible please open PDF file with Google chrome or Microsoft edge navigator or update your navigator)

Preventive Maintenance Completed
- Software upgrade to the latest released version.
- APC UPS down

Customer signature:

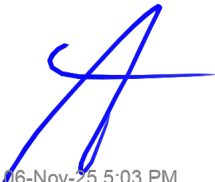
Name:

Date :

BST eltromat FRANCE signature:

Name:

Date :


06-Nov-25 5:03 PM


06-Nov-25 4:39 PM

ATTACHED PM'S FILE(S)

Picture 06112025	Screenshot 06112025
	