

On Customer Site

Visit Report

Reference :

Commande BSTe France : Offre 250801-0476 Rev. 1		Call / PM number : E2734	
Customer :	Vandeweghe nv-Flexo Printing	System :	Argus E Turbo 4K
Customer Contact :	M. Ronny Weynand	SN :	LS36935_428425
Customer Order number :	CDE AGEPA 25009119	Machine Nickname :	28

Visit Purpose :

Mechanical Preparation	☐	Installation	☐	Start-up	☐
Maintenance	☒	Under Contract	☐	Out of Contract	☒
Troubleshoot	☐	Under Warranty	☐	Out of Warranty	☐
Instruction	☐ Yes				
	☒ No				

	08/10/2025	09/10/2025				
Travel To	0	0.5				
Start Time	14h00	8h00				
Lunch Time	0.5	2				
End Time	17h00	12h00				
Travel From	0.5	5				

Details	Maintenance Préventive du système d'inspection sur presse Comexi F4. Archivage. Calibration du champ de vision et des GAIN
---------	---

Purpose of the visit completed : Yes ☒ No ☐

Need a new visit : Yes ☐ No ☒

On Customer Site

Maintenance Checklist for AVT Systems

Customer name and place : [Vandeweghe nv-Flexo Printing / Léon Bekaertlaan – 9880 – Aalter](#)

Contact person at customer : [M. Ronny Weynand \(Technical Sales\)](#)

Customer Mail & Mobile/Landline : ronny.weynand@agepa.com / +32 80 86 29 83

SN : [LS36935_428425](#)

Machine Manufacturer/Model/Nickname : [Comexi / F4 / 28](#)

Date : [09/10/2025](#)

Name : [Arnaud Darcel](#)

Comments :

Signatures :



09-Oct-25 11:30 AM

BST eltromat FSE



09-Oct-25 11:34 AM

Customer

On Customer Site

Prior to a Preventive Maintenance :

Check for system affecting modification reports and software releases.

Check for optional light source.

Check with customer about problems, or failure with the system.

1. Cleaning the optical parts :

OK/NOK/NA

- Mirror cleaned wit ZEISS lens wipes. ☒☐☐
- Camera lens cleaned with ZEISS lens wipes. ☒☐☐
- Reflectors cleaned with soft cloth using iso propanol or alcohol. ☐☐☒
- Back plate cleaned. ☒☐☐
- Computer filter cleaned/~~replaced~~ ☒☐☐

2. Camera calibration :

OK/NOK/NA

- Field of View / Period ☒☐☐

Main : 560.08 mm / 10.05

Second : 561.38 mm / 10.05
- Offset/Gain Calibration. ☐☐☒
- Zero LED calibration : Any/Zero/Dig ☐☐☒ Events

3. Check functioning of the Lamps :

OK/NOK/NA

- Lamps replacement. : Qty x0 -- > LED Illumination ☐☐☒
- Brightness and uniformity of the image checked. ☒☐☐

4. Replacement of the encoder wheel :

OK/NOK/NA

- Encoder wheel ~~replaced~~ and tightened ☒☐☐
- Spring replaced (if necessary) and spring force checked (ca. 1kg/10N) ☒☐☐

5. Software update :

OK/NOK/NA

- Software Update (if necessary). ☐☒☐

Old SW version : 5.6.4.0

New SW version : 5.6.4.0

On Customer Site

6. Final check of the running system :

OK/NOK/NA

- Stability of live image checked (without reference image).
- Stripe alignment checked (Normal and reflective mode).
- Registration checked.
- Maximum speed checked.
- Hard drive capacity checked.
- Backup created and saved locally and/or on USB stick.

☐	☒	☐
☒	☐	☐
☐	☒	☐
☐	☒	☐
☒	☐	☐
☒	☐	☐

7. Backup :

OK/NOK/NA

- BackupRestore
- Archive Printflow

☒	☐	☐
☒	☐	☐

Parts replaced during Preventive Maintenance :

- 1 -
- 2 -

Parts suggested to replace during the next Maintenance :

- | | |
|-----|-----|
| 1 - | 3 - |
| 2 - | 4 - |

Part need to be replaced as soon as possible :

- | | |
|-----|-----|
| 1 - | 3 - |
| 2 - | 4 - |

On Customer Site

Technical datas

Computer name : [NewImage](#)

Total Physical Memory : [32 GB](#)

Free Space in C Drive (System) : [189 / 244 GB](#)

Free Space in D Drive : [76.0 / 687 GB](#)

Free Space in F Drive (Backup) : [666 / 931 GB](#)

OS : [Windows Embedded 7 Service Pack 1 \(License WS7P\), Image Version 1.4](#)

Screen Resolution 1 : [1920x1080](#)

Screen Resolution 1 : [1920x1080](#)

Computer Model : [W-S 3U 2CAM 2MO ASMB-813 32 GB 700W](#)

ACB Firmware : [yr47 / yk47](#)

Remote Maintenance (Teamviewer)

IP address : [DHCP Automatic](#)

Subnet mask :

Default gateway :

Preferred DNS server :



Alternate DNS server :

Teamviewer ID / Version : [1 010 824 877 / v15](#)

On Customer Site

Notes

1 – PV Camera calibration

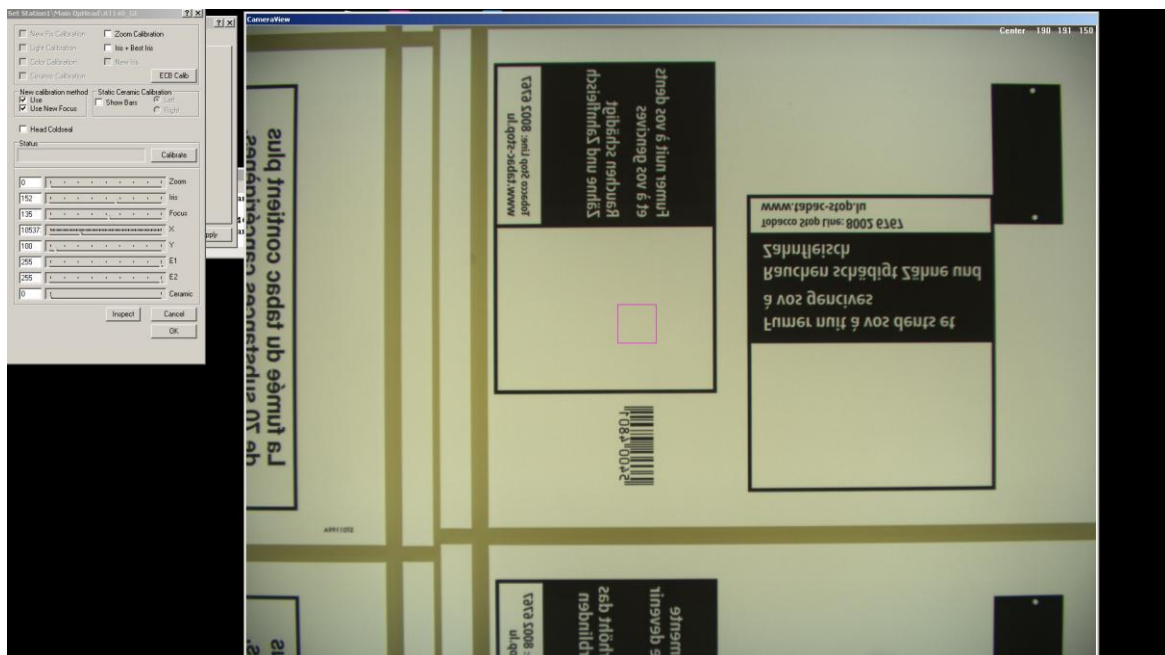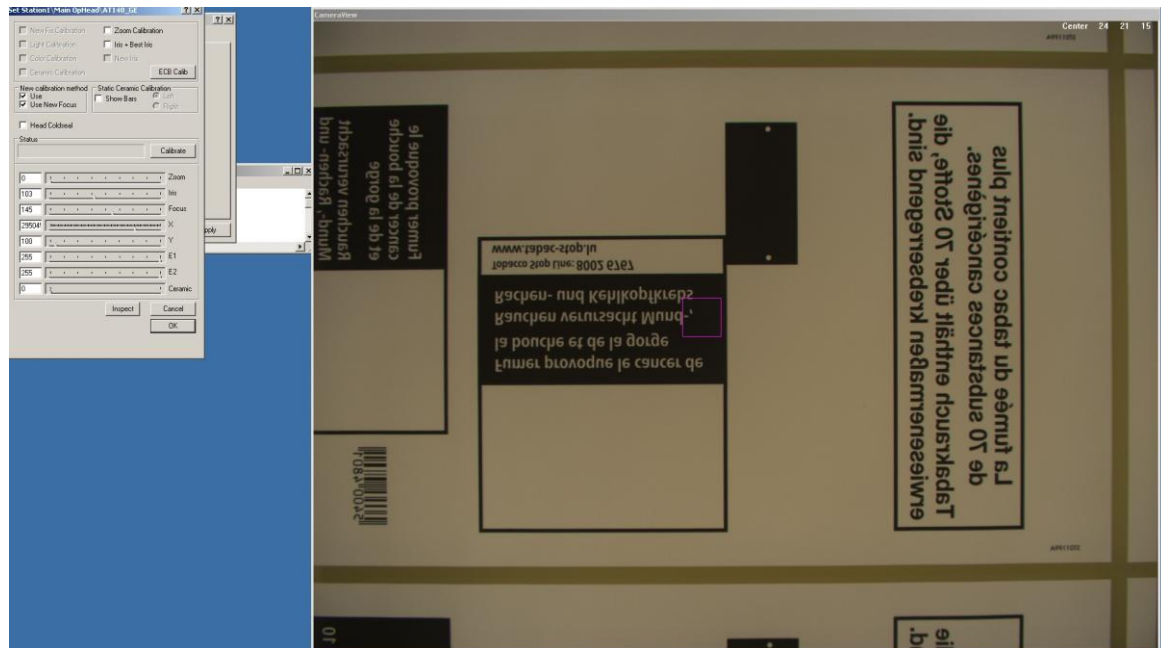


On Customer Site

2 – LCCD Focus Calibration

Station1-**Main OpHead**-CDalsaPiranha4




Station1-**Second OpHead**-CDalsaPiranha4

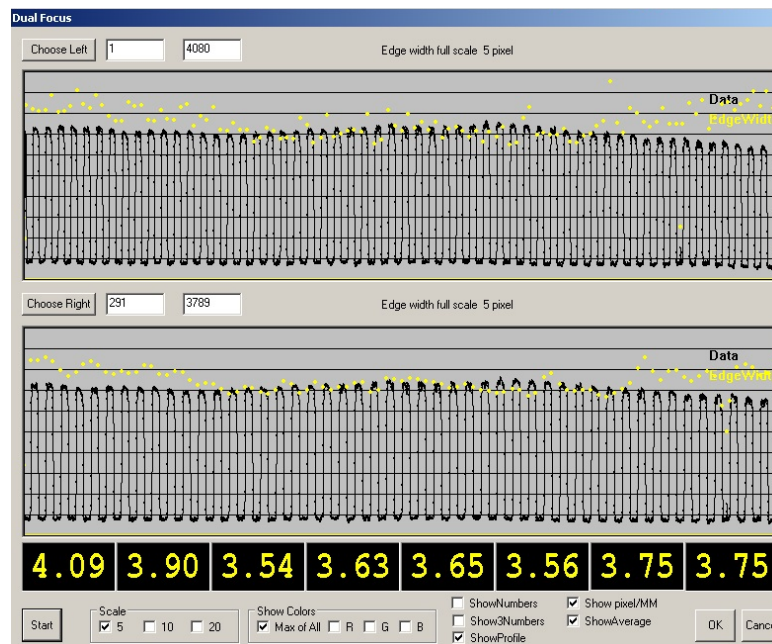

On Customer Site

3 – LCCD Field of View Calibration

Station1-**Main OpHead**-CDalsaPiranha4

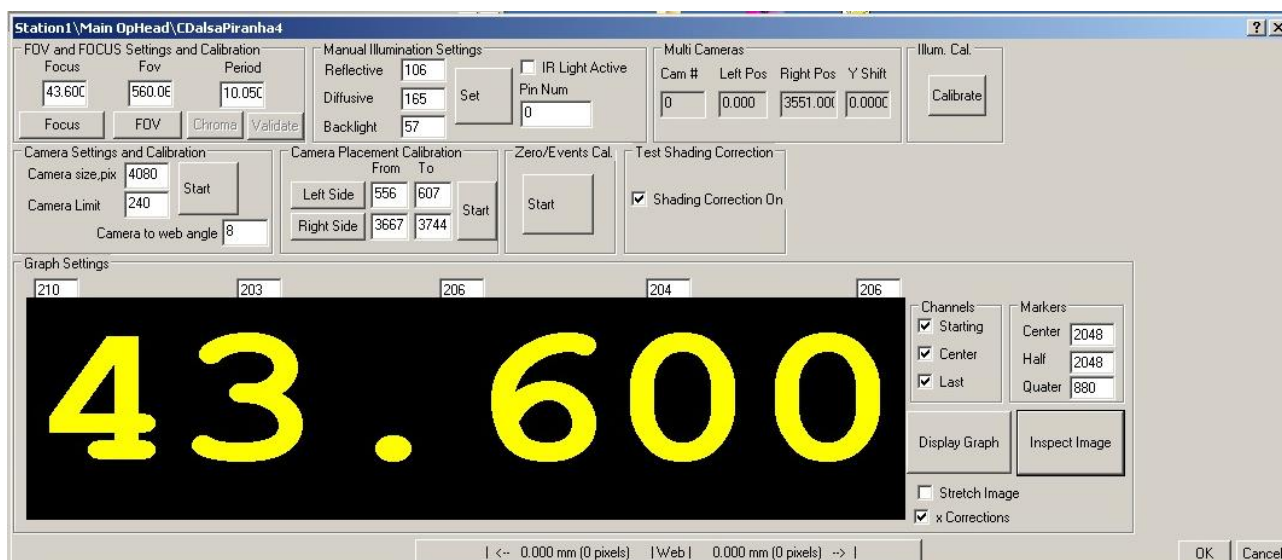


Station1-**Second OpHead**-CDalsaPiranha4




On Customer Site

4 – Gain Calibration

Station1-**Main OpHead**-CDalsaPiranha4

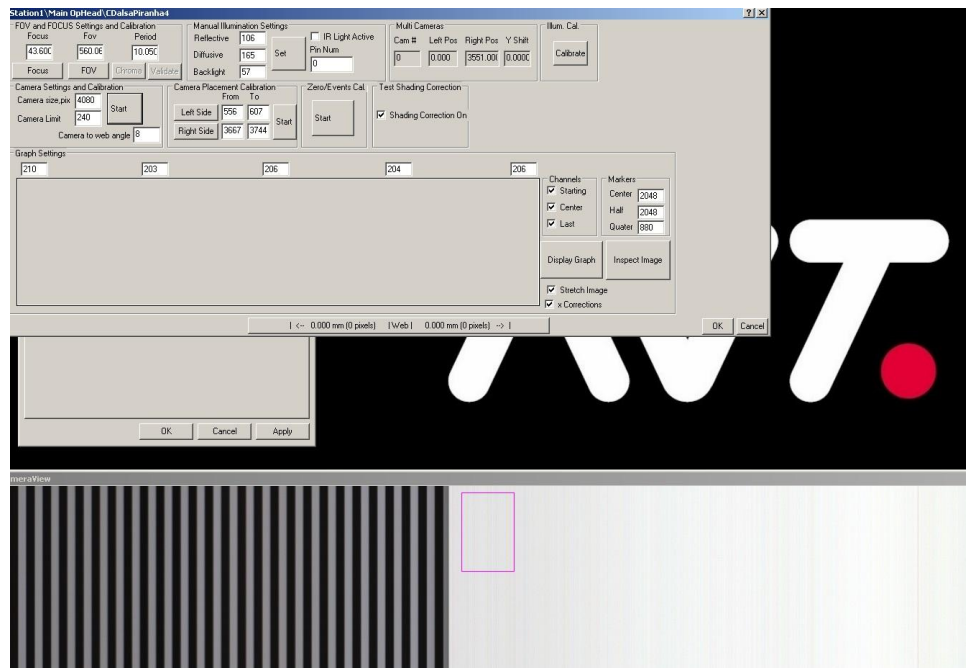

Station1-**Second OpHead**-CDalsaPiranha4

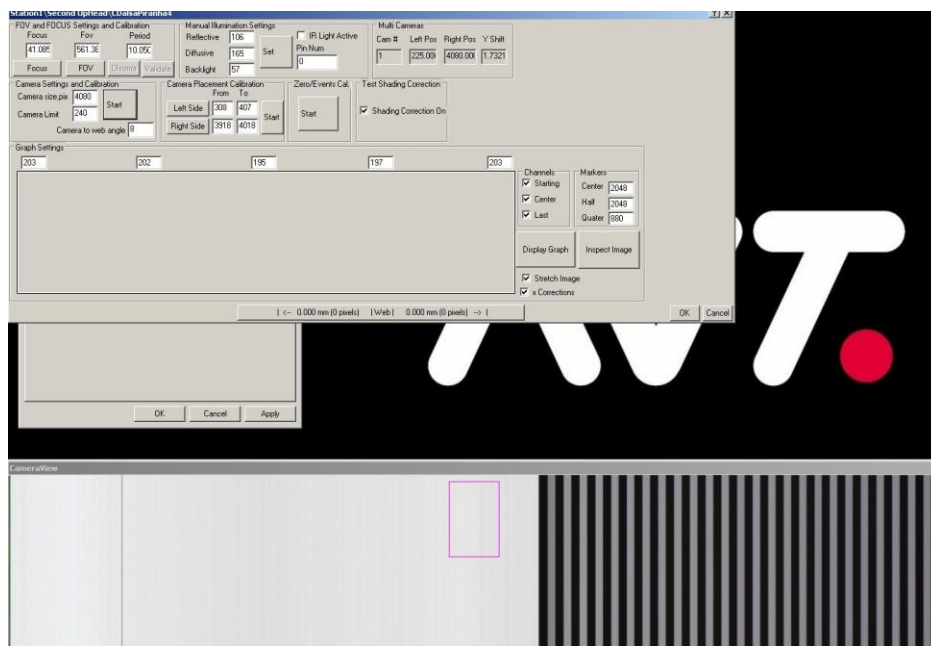

On Customer Site

Station1-Multi OpHead-MultiCCDCamera-Align Cameras Gain

