

On Customer Site

Visit Report

Reference :

Commande BSTe France : INT240206revA		Call / PM number : E2085	
Customer :	Sleeve International	System :	Helios S Turbo
Customer Contact :	M. Laurent Villard	SN :	400072
Customer Order number :	74122-210E-24	Machine Nickname :	Roto 1

Visit Purpose :

Mechanical Preparation	☐	Installation	☒	Start-up	☒
Maintenance	☒	Under Contract	☐	Out of Contract	☒
Troubleshoot	☒	Under Warranty	☐	Out of Warranty	☒
Instruction	☒ Yes				
	☐ No				

	06/05/2024	07/05/2024				
Travel To	2	0.25				
Start Time	9h30	8h30				
Lunch Time	0.75	0.75				
End Time	19h00	15h00				
Travel From	0.25	2				

Details	Réinstallation du système Helios S Turbo de la presse Roto 6 à la presse Roto 1. Maintenance préventive et paramétrage. Caméra Dalsa endommagée.
---------	--

Purpose of the visit completed : Yes ☒ No ☐

Need a new visit : Yes ☐ No ☒

On Customer Site

Maintenance Checklist for AVT Systems

Customer name and place : [Sleeve International / 15 avenue Arago, 91420 Morangis - France](#)

Contact person at customer / Title : [M. Laurent Villard \(Responsable Maintenance\)](#)

Customer Mail & Mobile/Landline : laurent.villard@sleeve.com / +33 1 69 74 76 61 / +33 6 64 45 85 69

System SN : [S-1004380_400072](#)

SOB SN : [216227](#)

Machine Manufacturer/Model/Nickname : [Sleeve / - / Roto 1](#)

Date : [07/05/2024](#)

Name : [Arnaud Darcel](#)

Comments :

Signatures :



Arnaud Darcel 2024-05-07T16:05:32+02:00

BST eltromat FSE



Laurent Villard 2024-05-07T16:05:08+02:00

Customer

On Customer Site

Prior to a Preventive Maintenance :

Check for system affecting modification reports and software releases.

Check for optional light source.

Check with customer about problems, or failure with the system.

1. Cleaning the optical parts :

OK/NOK/NA

- Mirror cleaned with ZEISS lens wipes. ☒ ☐ ☐
- Camera lens cleaned with ZEISS lens wipes. ☒ ☐ ☐
- Reflectors cleaned with soft cloth using iso propanol or alcohol. ☐ ☐ ☒
- Back plate cleaned. ☒ ☐ ☐
- Computer filter cleaned/replaced ☒ ☐ ☐

2. Camera calibration :

OK/NOK/NA

- Field of View / Period 414.00 mm / 9.93 ☒ ☐ ☐
- Zero LED calibration : Events ☒ ☐ ☐

3. Check functioning of the Lamps :

OK/NOK/NA

- Lamps replacement. : Qty x0 (LED) ☐ ☐ ☒
- Brightness and uniformity of the image checked. ☒ ☐ ☐

4. Replacement of the encoder wheel :

OK/NOK/NA

- Encoder wheel replaced and tightened ☐ ☒ ☐
- Spring replaced (if necessary) and spring force checked (ca. 1kg/10N) ☒ ☐ ☐

5. Software update :

OK/NOK/NA

- Software Update (if necessary). ☐ ☒ ☐

Old SW version : 5.6.0.3

New SW version : 5.6.0.3

On Customer Site

6. Final check of the running system :

OK/NOK/NA

- Stability of live image checked (without reference image).
- Stripe alignment checked (Normal and reflective mode).
- Registration checked.
- Maximum speed checked.
- Hard drive capacity checked.
- Backup created and saved locally and/or on USB stick.

☐	☐	☒
☒	☐	☐
☒	☐	☐
☒	☐	☐
☒	☐	☐
☒	☐	☐

7. Backup :

OK/NOK/NA

- BackupRestore
- Archive Printflow

☒	☐	☐
☐	☒	☐

Parts replaced during Preventive Maintenance :

- | | |
|---------------------|-----|
| 1 – Computer Filter | 3 - |
| 2 - | 4 - |

Parts suggested to replace during the next Maintenance :

- | | |
|-----|-----|
| 1 - | 3 - |
| 2 - | 4 - |

Part need to be replaced as soon as possible :

- | | |
|-----|-----|
| 1 - | 3 - |
| 2 - | 4 - |

On Customer Site

Technical datas

Computer name : [AVT- ROTO1](#)

Total Physical Memory : [16 GB](#)

Free Space in C Drive (System) : [127 / 244 GB](#)

Free Space in D Drive : [677 / 686 GB](#)

Free Space in F Drive (Backup) : [812 / 931 GB](#)

OS : [Windows Embedded Standard SP1](#)

Screen Resolution 1 : [1920x1080](#)

Computer : [95223666 – SOB3 AP-HL LED COL P4 FG WIN7 FUJI 16G 3M V5.6.0](#)

Date : [April, 2017](#)

SN : [216227](#)

ACB Firmware : [yr35/yk35](#)

Remote Maintenance (Teamviewer)

IP address : [192.168.130.8](#)

Subnet mask : [255.255.255.0](#)

Default gateway : [192.168.130.245](#)

Preferred DNS server : [192.168.130.249](#)



Alternate DNS server : [192.168.130.250](#)

Teamviewer ID / Version : [684 352 097 / v11](#)

On Customer Site


Notes

- Camera Dalsa Piranha4 (Euresys) defect :

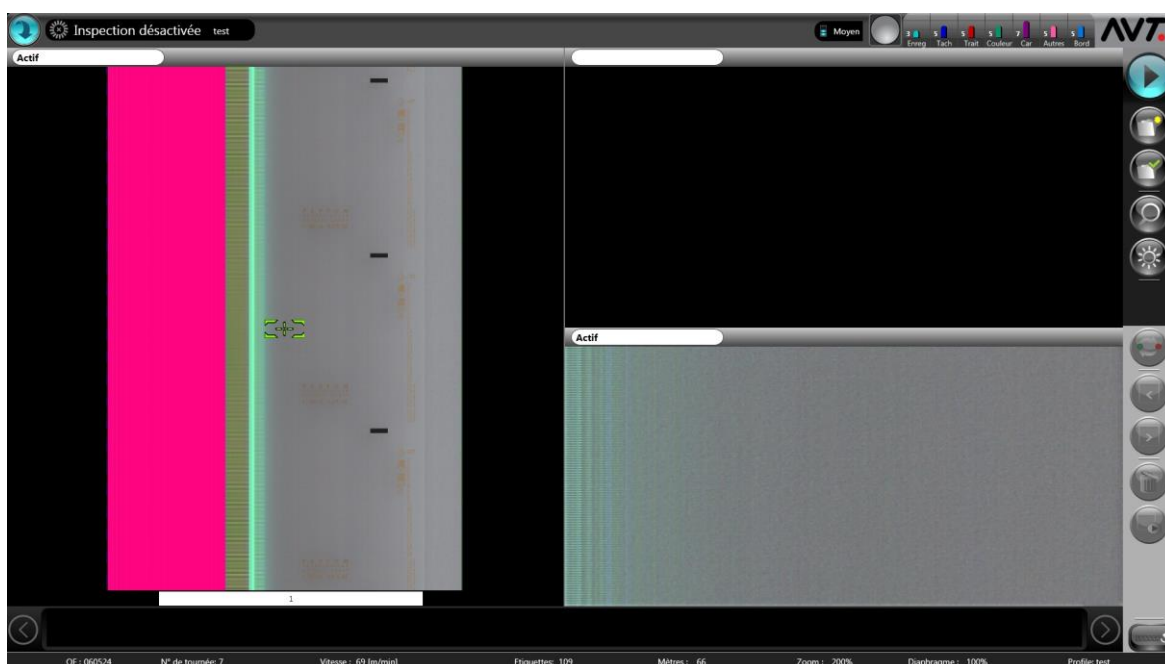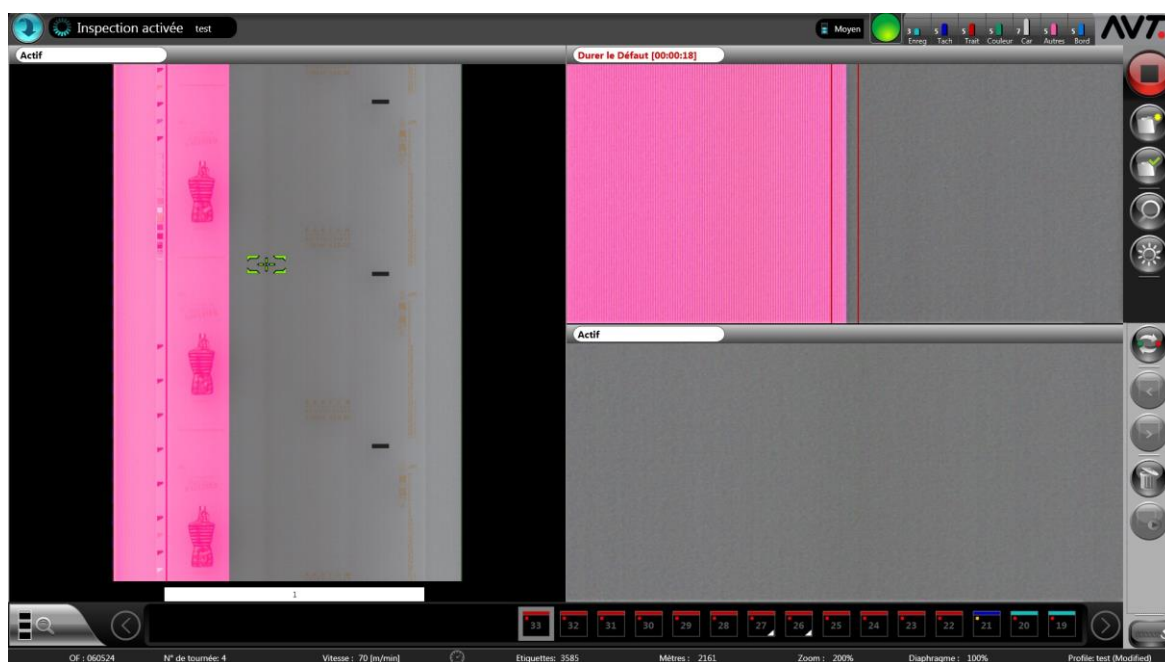

On Customer Site

Last Job produced :

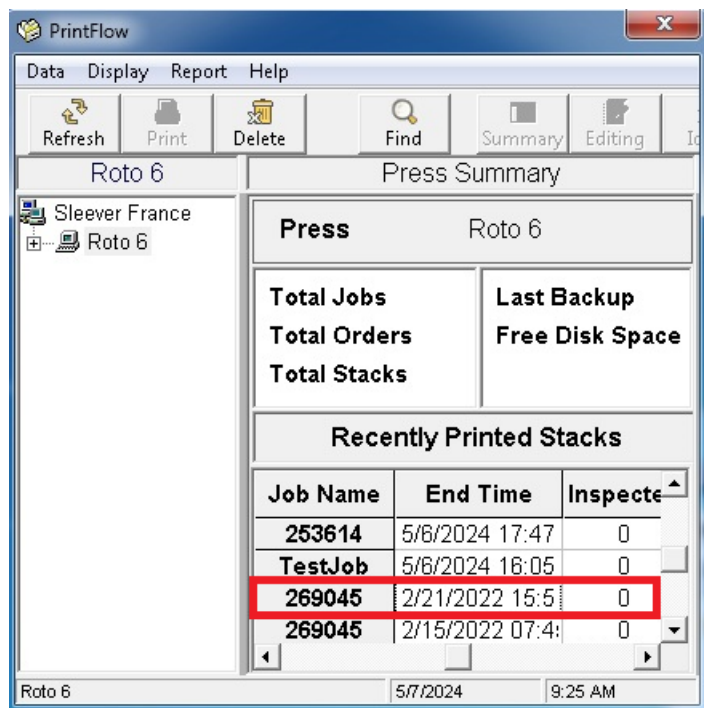

Press Summary

Press Roto 6

Total Jobs	Last Backup
Total Orders	Free Disk Space
Total Stacks	

Recently Printed Stacks

Job Name	End Time	Inspected
253614	5/6/2024 17:47	0
TestJob	5/6/2024 16:05	0
269045	2/21/2022 15:5	0
269045	2/15/2022 07:4	0

Roto 6 5/7/2024 9:25 AM