

On Customer Site

Visit Report

Reference :

Commande BSTe France : Offre 250801-0476 Rev. 1		Call / PM number : E2733	
Customer :	Vandeweghe nv-Flexo Printing	System :	Argus Elite
Customer Contact :	M. Ronny Weynand	SN :	LS24137_304554
Customer Order number :	CDE AGEPA 25009119	Machine Nickname :	58

Visit Purpose :

Mechanical Preparation	☐	Installation	☐	Start-up	☐
Maintenance	☒	Under Contract	☐	Out of Contract	☒
Troubleshoot	☐	Under Warranty	☐	Out of Warranty	☐
Instruction	☐ Yes				
	☒ No				

	08/10/2025					
Travel To	2.5					
Start Time	09h30					
Lunch Time	0.5					
End Time	14h00					
Travel From	0					

Details	Maintenance Préventive du système d'inspection sur presse Comexi F4. Archivage. Calibration du champ de vision et des GAIN Remplacement du Clavier Argus
---------	--

Purpose of the visit completed : Yes ☒ No ☐

Need a new visit : Yes ☐ No ☒

On Customer Site

Maintenance Checklist for AVT Systems

Customer name and place : [Vandeweghe nv-Flexo Printing / Léon Bekaertlaan – 9880 – Aalter](#)

Contact person at customer : [M. Ronny Weynand \(Technical Sales\)](#)

Customer Mail & Mobile/Landline : ronny.weynand@agepa.com / +32 80 86 29 83

SN : [LS24137_304554](#)


Machine Manufacturer/Model/Nickname : [Comexi / F4 / 58](#)

Date : [09/10/2025](#)

Name : [Arnaud Darcel](#)

Comments :

Signatures :

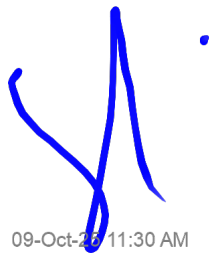

09-Oct-25 11:30 AM

BST eltromat FSE



09-Oct-25 11:34 AM

Customer

On Customer Site

Prior to a Preventive Maintenance :

Check for system affecting modification reports and software releases.

Check for optional light source.

Check with customer about problems, or failure with the system.

1. Cleaning the optical parts :

OK/NOK/NA

- Mirror cleaned with ZEISS lens wipes. ☒☐☐
- Camera lens cleaned with ZEISS lens wipes. ☒☐☐
- Reflectors cleaned with soft cloth using iso propanol or alcohol. ☐☐☒
- Back plate cleaned. ☒☐☐
- Computer filter cleaned/~~replaced~~ ☒☐☐

2. Camera calibration :

OK/NOK/NA

- Field of View / Period 1061.7 mm / 10.05 ☒☐☐
- Offset/Gain Calibration. 122/122/117 – 66/61/56 – 15/13/12 (White (LF)) ☒☐☐
- Zero LED calibration : Any/Zero/Dig 131/130/130 ☒☐☐

3. Check functioning of the Lamps :

OK/NOK/NA

- Lamps replacement. : Qty x0 ☐☒☐
- Brightness and uniformity of the image checked. ☒☐☐

4. Replacement of the encoder wheel :

OK/NOK/NA

- Encoder wheel ~~replaced~~ and tightened ☒☐☐
- Spring replaced (if necessary) and spring force checked (ca. 1kg/10N) ☒☐☐

5. Software update :

OK/NOK/NA

- Software Update (if necessary). ☐☒☐

Old SW version : 5.1.0

New SW version : 5.1.0

On Customer Site

6. Final check of the running system :

OK/NOK/NA

- Stability of live image checked (without reference image).
- Stripe alignment checked (Normal and reflective mode).
- Registration checked.
- Maximum speed checked.
- Hard drive capacity checked.
- Backup created and saved locally and/or on USB stick.

☐	☒	☐
☒	☐	☐
☐	☒	☐
☐	☒	☐
☒	☐	☐
☒	☐	☐

7. Backup :

OK/NOK/NA

- BackupRestore
- Archive Printflow

☒	☐	☐
☒	☐	☐

Parts replaced during Preventive Maintenance :

- 1 -
- 2 -

Parts suggested to replace during the next Maintenance :

- | | |
|-----|-----|
| 1 - | 3 - |
| 2 - | 4 - |

Part need to be replaced as soon as possible :

- | | |
|-----|-----|
| 1 - | 3 - |
| 2 - | 4 - |

On Customer Site

Technical datas

Computer name : [Press58](#)

Total Physical Memory : [16 GB](#)

Free Space in C Drive (System) : [25.0 / 49.9 GB](#) Free Space in D Drive : [152 / 415 GB](#)

Free Space in F Drive (Backup) : [446 / 465 GB](#)

OS : [Windows 7 Embedded SP1 – v740](#)

Screen Resolution 1 : [1920x1080](#)

Screen Resolution 1 : [1920x1080](#)

Computer Model : [SOB3 AR.ELITE X79TO 3MON COL ACBM.CAM 16G V5.0.2](#)

Date : [Aug, 2014](#)

ACB Firmware : [yr27 / yk27](#)

Remote Maintenance (Teamviewer)

IP address : [DHCP Automatic](#)

Subnet mask :

Default gateway :

Preferred DNS server :

Alternate DNS server :


Teamviewer ID / Version :

On Customer Site

Notes

1 – LCCD Field of View Calibration

Station1-Main OpHead-CDalsa4KColor

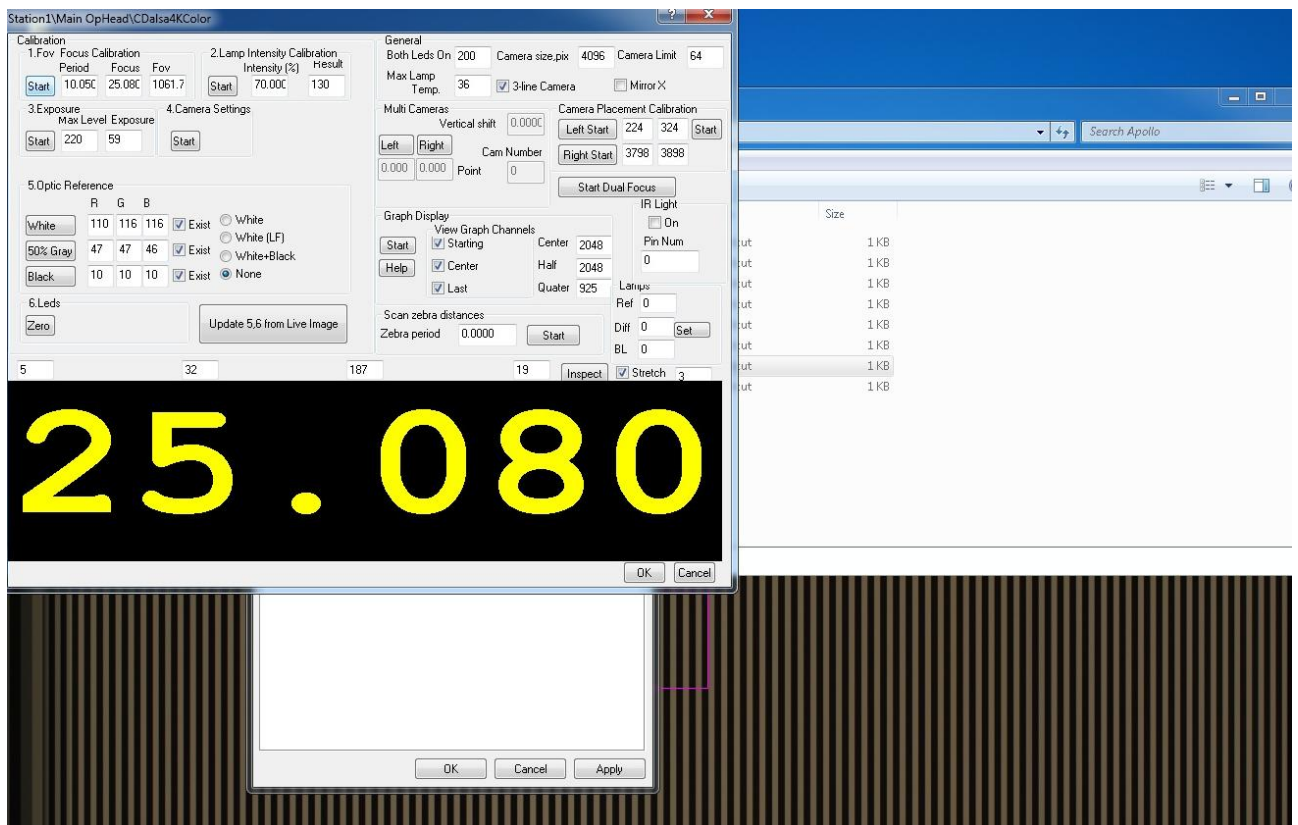

On Customer Site

2 – Gain Calibration

Station1-Main OpHead-CDalsa4KColor

