

On Customer Site

Visit Report

Reference :

Commande BSTe France : CM2105039		Commande BSTe Int. : PM963	
Customer :	Etik Ouest (Soullans)	System :	Helios II 445mm
Customer Contact :	Mme Nadège Thué	SN :	200344
Customer Order number :	CM2105039 Signé	Machine Nickname :	X4

Visit Purpose :

Mechanical Preparation	☐	Installation	☐	Start-up	☐
Maintenance	☒	Under Contract	☒	Out of Contract	☐
Troubleshoot	☐	Under Warranty	☐	Out of Warranty	☐
Instruction	☐ Yes				
	☒ No				

	16/09/2025					
Travel To	0					
Start Time	10h30					
Lunch Time	0					
End Time	12h30					
Travel From	0					

Details	Maintenance Préventive du système Helios II 445 mm sur Press Omet X4 suivant check list. Lamps must be urgently replaced : Gain result = 100
---------	---

Purpose of the visit completed : Yes ☒ No ☐

Need a new visit : Yes ☐ No ☒

On Customer Site

Maintenance Checklist for Inspection Systems

Available supporting documents :

- Check list for maintenance

Customer name and place : [Etik Ouest / ZA, Route des Borgnières – 85300 - Soullans](#)

Contact person at customer : [Mme Nadège Thué](#)

Customer Mail & Mobile/Landline : nthue@etikouest.com / +33 2 51 49 17 27

System Type : [Helios II 445mm](#)

SN : [200344](#)


Machine Manufacturer/Model/Nickname : [Omet / X4 440 / X4](#)

Date : [16/09/2025](#)

Name : [Arnaud Darcel](#)


Comments :

Signatures :

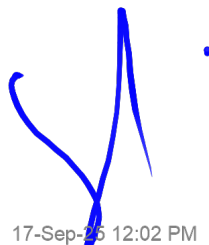

17-Sep-25 12:02 PM

BST eltromat FSE

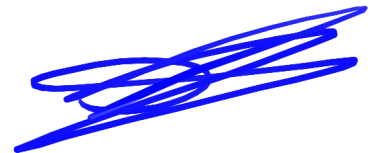

17-Sep-25 11:58 AM

Customer

On Customer Site

Prior to a Preventive Maintenance :

Check with customer about problems, or failure with the system.

1. Cleaning the optical parts :

OK/NA

- Mirror cleaned with ZEISS lens wipes. ☒ ☐
- Camera lens cleaned with ZEISS lens wipes. ☒ ☐
- Reflectors cleaned with soft cloth using iso propanol or alcohol. ☒ ☐
- Back plate cleaned. ☒ ☐
- Computer filter cleaned/~~replaced~~ ☒ ☐

2. Camera calibration :

OK/NA

- Field of View / Period 10.05 : [526.92 mm](#) ☒ ☐
- Offset/Gain Calibration : [101/115/117 – 34/39/42 – 0/3/7 \(White \(LF\)\)](#) ☒ ☐
- Zero LED calibration : Anyspeed & Zero Signal : [AnySpeed 129](#) ☒ ☐

3. Check functioning of the Lamps :

OK/NA

- Lamps replacement. : [Qty x2 - 23720009](#) ☐ ☒
- Brightness and uniformity of the image checked. ☒ ☐

4. Replacement of the encoder wheel :

OK/NA

- Encoder wheel replaced and tightened -- > [Cleaned](#) ☐ ☒
- Spring replaced (if necessary) and spring force checked (ca. 1kg/10N) ☒ ☐

5. Software update :

OK/NA

- Software Update (if necessary). ☐ ☒

Old SW version : [5.5.0.0](#)

New SW version : [5.5.0.0](#)

On Customer Site

6. Final check of the running system :

OK/NA

- Stability of live image checked (without reference image). ☒ ☐
- Stripe alignment checked (Normal and reflective mode). ☒ ☐
- Registration checked. ☒ ☐
- Maximum speed checked. ☒ ☐
- Hard drive capacity checked. ☒ ☐
- Backup created and saved locally and/or on USB stick. ☒ ☐

7. Backup :

OK/NA

- BackupRestore ☒ ☐
- Archive Printflow ☒ ☐
- Acronis ☐ ☒

Parts replaced during Preventive Maintenance :

- | | |
|-----|-----|
| 1 - | 3 - |
| 2 - | 4 - |

Parts suggested to replace during the next Maintenance :

- | | |
|--|-----|
| 1 - Lamps 23720009 Qty 2 | 3 - |
| 2 - | 4 - |

Part need to be replaced as soon as possible :

- | | |
|--|-----|
| 1 - Lamps 23720009 Qty 2 | 3 - |
| 2 - | 4 - |

On Customer Site

Technical datas

Computer name : [AVT-OMET-X4](#)

Total Physical Memory : [32 GB](#)

Free Space in C Drive (System) : [187 / 244 GB](#)

Free Space in D Drive : [339 / 687 GB](#)

Free Space in F Drive (Backup) : [55.5 / 931 GB](#)

OS : [Windows Embedded Standard SP1](#)

Screen Resolution Touch : [1920x1080](#)

Computer Model : [95203694 / ASMB-813](#)

Date : [Jun, 2018](#)

Remote Maintenance (Teamviewer)

IP address : [\(DHCP Automatic\)](#)

Subnet mask :

Default gateway :

Preferred DNS server :

Alternate DNS server :


Teamviewer ID / Version : [557 254 170 / v15](#)

On Customer Site

Notes

- Calibration

- Before Calibration

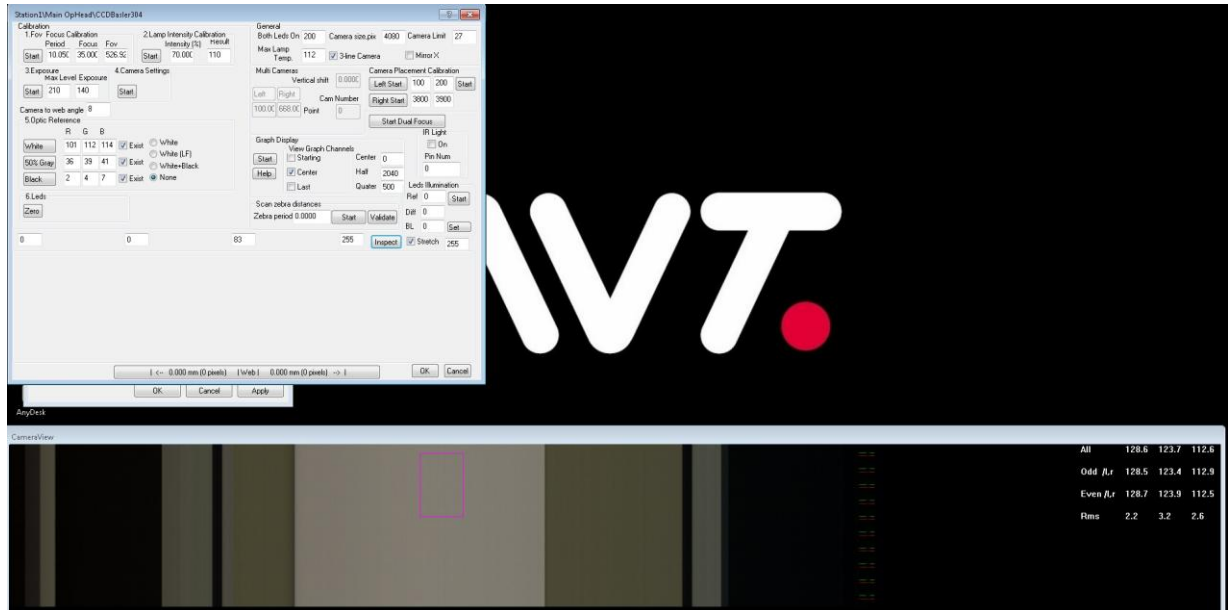

- After Calibration

