

On Customer Site

Visit Report

Reference :

Commande BSTe France : CM2105039		Commande BSTe Int. : PM699	
Customer :	Etik Ouest (Soullans)	System :	Helios II 660mm
Customer Contact :	M. Sylvian Gandemer	SN :	1004601
Customer Order number :	CM2105039	Machine Nickname :	D4

Visit Purpose :

Mechanical Preparation	☐	Installation	☐	Start-up	☐
Maintenance	☒	Under Contract	☒	Out of Contract	☐
Troubleshoot	☐	Under Warranty	☐	Out of Warranty	☐
Instruction	☐ Yes				
	☒ No				

	26/08/2024					
Travel To	5					
Start Time	14h00					
Lunch Time	0					
End Time	16h00					
Travel From	0					

Details	Maintenance Préventive du système Helios II 660 mm sur machine D4 suivant check list.
---------	---

Purpose of the visit completed : Yes ☒ No ☐

Need a new visit : Yes ☐ No ☒

On Customer Site

Maintenance Checklist for Inspection Systems

Available supporting documents :

- Check list for maintenance

Customer name and place : [Etik Ouest / ZA, Route des Borgnières – 85300 - Soullans](#)

Contact person at customer : [M. Sylvain Gandemer](#)

Customer Mail & Mobile/Landline : sgandemer@etikouest.com / [+33 2 51 49 17 27](tel:+33251491727)

System Type : [Helios II 660mm](#)

SN : [1004601](#)

Machine Manufacturer/Model/Nickname : [GIC / ??? / D4](#)

Date : [26/08/2024](#)

Name : [Arnaud Darcel](#)

Comments :

Signatures :



mardi 27 août 2024 15:46:58

BST eltromat FSE



mardi 27 août 2024 15:47:15

Customer

On Customer Site

Prior to a Preventive Maintenance :

Check with customer about problems, or failure with the system.

1. Cleaning the optical parts :

OK/NA

- Mirror cleaned with ZEISS lens wipes. ☐ ☒
- Camera lens cleaned with ZEISS lens wipes. ☒ ☐
- Reflectors cleaned with soft cloth using iso propanol or alcohol. ☒ ☐
- Back plate cleaned. ☒ ☐
- Computer filter cleaned/~~replaced~~ ☒ ☐

2. Camera calibration :

OK/NA

- Field of View / Period 10.05 : [740.25 mm](#) ☒ ☐
- Offset/Gain Calibration : [172/189/174 – 76/74/70 – 8/9/7 \(None\)](#) ☒ ☐
- Zero LED calibration : Anyspeed & Zero Signal : [AnySpeed 137](#) ☒ ☐

3. Check functioning of the Lamps :

OK/NA

- Lamps replacement. : [Qty x3 - 23720002](#) ☐ ☒
- Brightness and uniformity of the image checked. ☒ ☐

4. Replacement of the encoder wheel :

OK/NA

- Encoder wheel replaced and tightened ☐ ☒
- Spring replaced (if necessary) and spring force checked (ca. 1kg/10N) ☒ ☐

5. Software update :

OK/NA

- Software Update (if necessary). ☒ ☐

Old SW version : [5.5.0.0](#)

New SW version : [5.5.0.0](#)

On Customer Site

6. Final check of the running system :

OK/NA

- Stability of live image checked (without reference image). ☒ ☐
- Stripe alignment checked (Normal and reflective mode). ☒ ☐
- Registration checked. ☒ ☐
- Maximum speed checked. ☐ ☒
- Hard drive capacity checked. ☒ ☐
- Backup created and saved locally and/or on USB stick. ☒ ☐

7. Backup :

OK/NA

- BackupRestore ☒ ☐
- Archive Printflow ☒ ☐
- Acronis ☐ ☒

Parts replaced during Preventive Maintenance :

- | | |
|-----|-----|
| 1 - | 3 - |
| 2 - | 4 - |

Parts suggested to replace during the next Maintenance :

- | | |
|--|-----|
| 1 - Lamps 23720002 Qty 3 | 3 - |
| 2 - | 4 - |

Part need to be replaced as soon as possible :

- | | |
|-----|-----|
| 1 - | 3 - |
| 2 - | 4 - |

On Customer Site

Technical datas

Computer name : [AVT-D4](#)

Total Physical Memory : [16 GB](#)

Free Space in C Drive (System) : [28.8 / 49.9 GB](#)

Free Space in D Drive : [357 / 415 GB](#)

Free Space in F Drive (Backup) : [255 / 465 GB](#)

OS : [Windows Embedded Standard SP1 v7.740](#)

Screen Resolution Touch : [1920x1080](#)

Computer Model : [95203515 / X79TO](#)

Date : [Nov, 2014](#)

Remote Maintenance (Teamviewer)

IP address : [\(DHCP Automatic\)](#)

Subnet mask :

Default gateway :

Preferred DNS server :

Alternate DNS server :


Teamviewer ID / Version : [558 227 945 / v12 \(No cable\)](#)

On Customer Site

Notes

1- Gain calibration : Lamps not replaced

Before calibration :

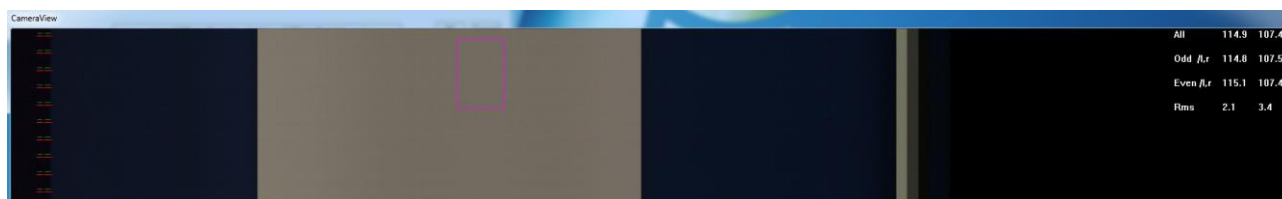

After calibration :



2- SOB Filter



On Customer Site

3- Field of View calibration

