

On Customer Site

Visit Report

Reference :

Commande BSTe France :		Call / PM number : PM645	
Customer :	AMCOR	System :	AVT Jupiter
Customer Contact :	M. Mercky	SN :	802104
Customer Order number :		Machine Nickname :	362

Visit Purpose :

Mechanical Preparation	☐	Installation	☐	Start-up	☐
Maintenance	☒	Under Contract	☐	Out of Contract	☒
Troubleshoot	☐	Under Warranty	☐	Out of Warranty	☐
Instruction	☐ Yes				
	☒ No				

	16 / 05 /2024					
Travel To	0.5					
Start Time	8h15					
Lunch Time	0					
End Time	10h00					
Travel From	4.5					

Details	Maintenance Préventive du système d'inspection sur Rotomec 362
---------	--

Purpose of the visit completed : Yes ☒ No ☐

Need a new visit : Yes ☐ No ☒

On Customer Site

Maintenance Checklist for Inspection Systems

Customer name and place : [Amcor Selestat](#) , 8 Rue de St Hippolyte, 67600 Sélestat

Contact person at customer : [M. Nicolas Mercky](#) (Coordinateur instrumentation)

Customer Mail & Mobile/Landline : nicolas.mercky@amcor.com/03 88 58 36 93

SN : [802104](#)


Machine Manufacturer/Model/Nickname : [Gravure/Cerruti/362](#)

Date : [16/05/2024](#)

Name : [David TONDU](#)

Comments :

Signatures :

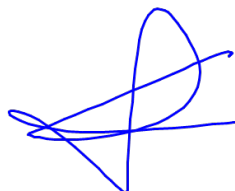

Richard Relin 2024-05-17T15:09:03+02:00

BST eltromat FSE



Nicolas Mercky 2024-05-16T16:14:52+02:00

Customer

On Customer Site

Prior to a Preventive Maintenance :

Check for system affecting modification reports and software releases.

Check for optional light source.

Check with customer about problems, or failure with the system.

1. Cleaning the optical parts :

OK/NOK/NA

- Mirror cleaned with ZEISS lens wipes. ☒ ☐ ☐
- Camera lens cleaned with ZEISS lens wipes. ☒ ☐ ☐
- Reflectors cleaned with soft cloth using iso propanol or alcohol. ☐ ☐ ☒
- Back plate cleaned. ☐ ☐ ☒
- Computer filter ~~cleaned~~/replaced ☒ ☐ ☐

2. Camera calibration :

OK/NOK/NA

- Field of View / Period ☐ ☐ ☒
- Offset/Gain Calibration. ☐ ☐ ☒
- Zero LED calibration : Anyspeed & Position ☐ ☐ ☒

3. Check functioning of the Lamps :

OK/NOK/NA

- Lamps replacement. : ☐ ☐ ☒
- Brightness and uniformity of the image checked. ☒ ☐ ☐

4. Replacement of the encoder wheel :

OK/NOK/NA

- Encoder wheel replaced and tightened ☐ ☐ ☒
- Spring replaced (if necessary) and spring force checked (ca. 1kg/10N) ☐ ☐ ☒

5. Software update :

OK/NOK/NA

- Software Update (if necessary). ☐ ☒ ☐

Old SW version : [2.9.1.1](#)

New SW version : [2.9.1.1](#)

On Customer Site

6. Final check of the running system :

OK/NOK/NA

- Stability of live image checked (without reference image).
- Stripe alignment checked (Normal and reflective mode).
- Registration checked.
- Maximum speed checked.
- Hard drive capacity checked.
- Backup created and saved locally and/or on USB stick.

☒	☐	☐
☒	☐	☐
☒	☐	☐
☐	☒	☐
☒	☐	☐
☒	☐	☐

7. Backup :

OK/NOK/NA

- BackupRestore
- Archive Printflow

☒	☐	☐
☐	☐	☒

Parts replaced during Preventive Maintenance :

- | | |
|-----|-----|
| 1 - | 3 - |
| 2 - | 4 - |

Parts suggested to replace during the next Maintenance :

- | | |
|-----|-----|
| 1 - | 3 - |
| 2 - | 4 - |

Part need to be replaced as soon as possible :

- | | | |
|---------------------------|-------------------------|-----|
| 1 - LE SYTEME COMPLET (🔄) | code promo : DT240515DT | 3 - |
| 2 - | | 4 - |

On Customer Site

Technical datas

Computer name : [362](#)

Total Physical Memory : [2 GB](#)

Free Space in C Drive (System) : [46.75 GB](#)

Free Space in D Drive : [346GB](#)

OS : [Microsoft Windows XP Professional 2002 – SP2](#)

Screen Resolution 1 : [1600x600](#)

Screen Resolution 2 : [1280x1024 \(Not Active\)](#)

Computer Model : [INTEL PX 7654 AS GIG](#)

Date : [August, 2017](#)

ACB Firmware : [XP2-LT](#)

Remote Maintenance (Teamviewer)

IP address : [NA](#)

Subnet mask :

Default gateway :

Preferred DNS server :

Alternate DNS server :


Teamviewer ID / Version :

On Customer Site

Notes

- **RGB Calibration**


- **Zoom/Iris/Focus Calibration**

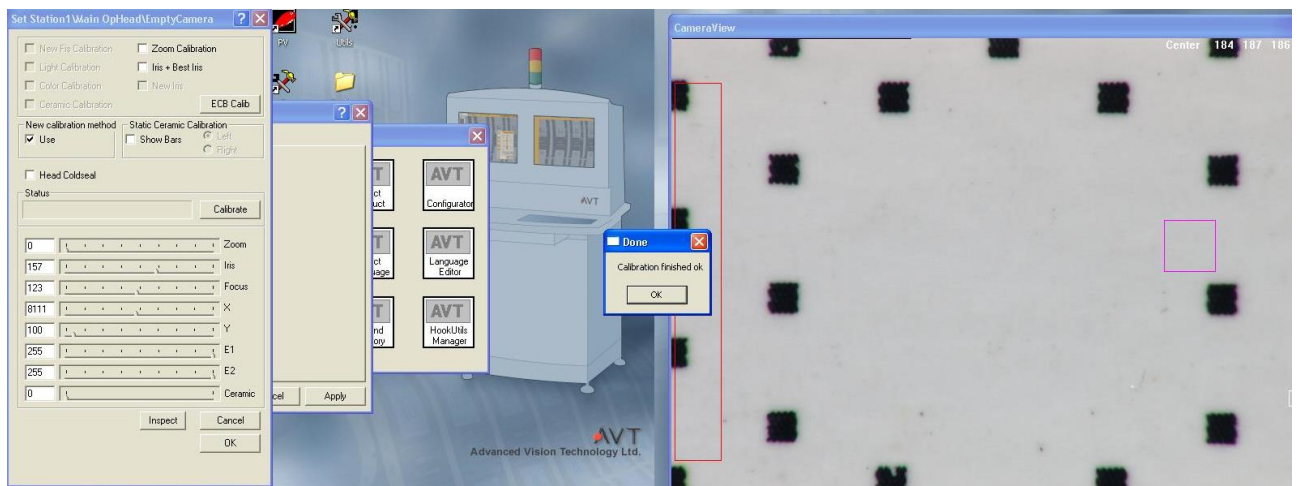

- **Ceramic Calibration**


- **Loop test**

On Customer Site

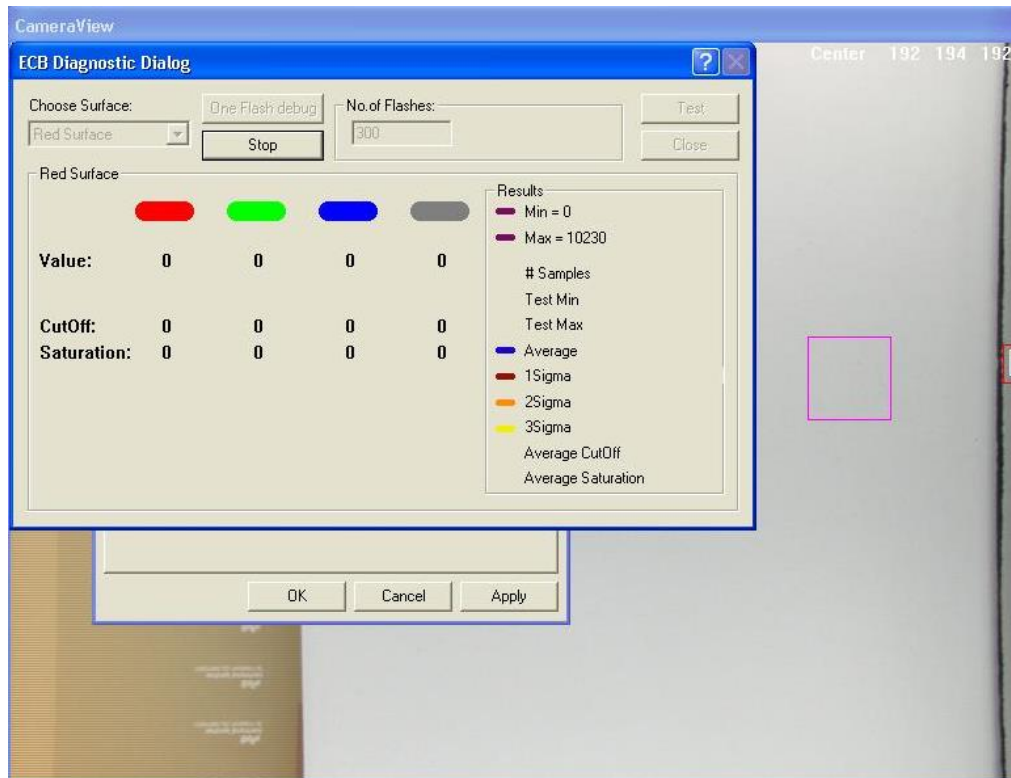

- ECB Calibration

On Customer Site

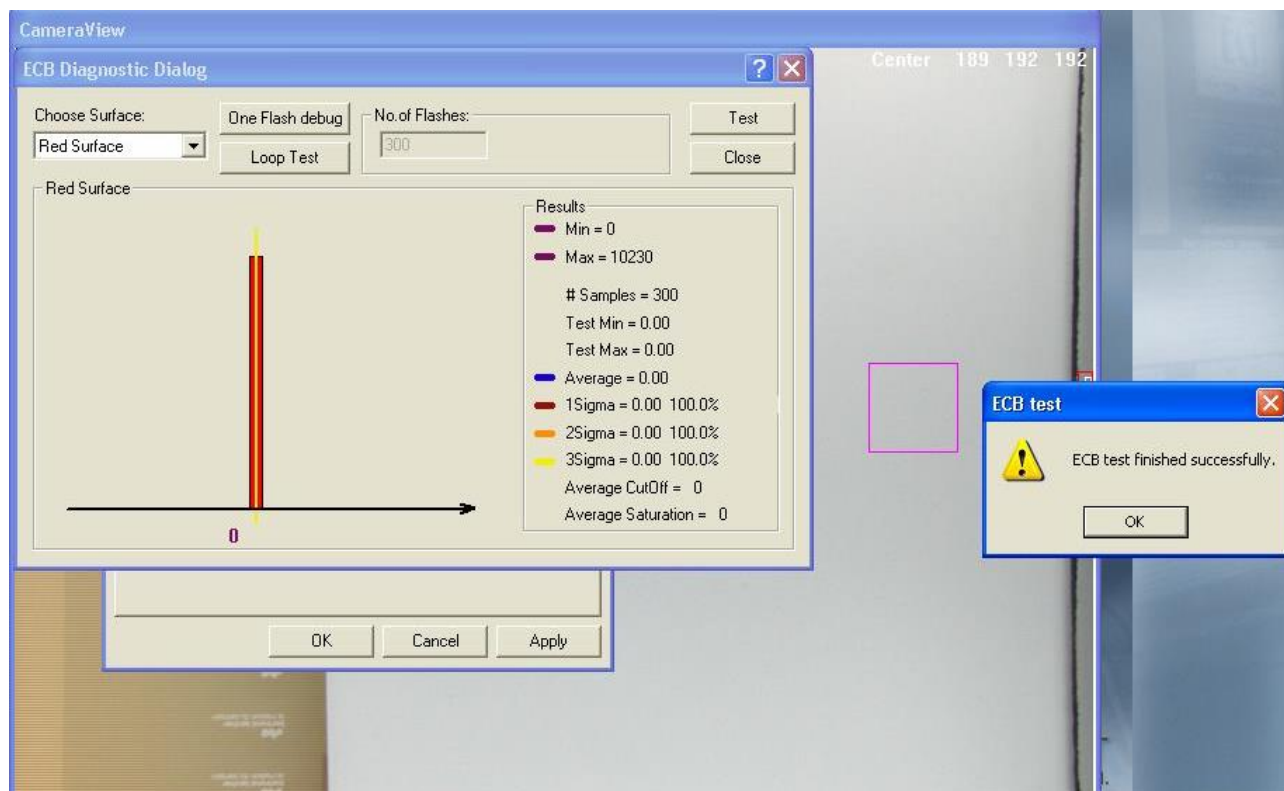

On Customer Site
